



NUMBER: 23-037-17 REV. A

GROUP: 23 - Body

DATE: September 23, 2017

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

THIS BULLETIN SUPERSEDES SERVICE BULLETIN 23-037-17, DATED AUGUST 22, 2017, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **ASTERISKS**** AND INCLUDES REMOVING SALES CODES AND THIS BULLETIN COVERS ALL MODELS AND DRIVETRAIN.**

THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL (RRT) 17-080. ALL APPLICABLE SOLD AND UN-SOLD RRT VIN's HAVE BEEN LOADED. TO VERIFY THAT THIS RRT SERVICE ACTION IS APPLICABLE TO THE VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.

SUBJECT:

Odor Coming from Engine Compartment

OVERVIEW:

This bulletin involves replacing the cowl seal gasket and sealing off the two vent holes in the hood.

MODELS:

2017 (GA) Alfa Romeo Giulia

NOTE: This bulletin applies to vehicles within the following markets/countries: NAFTA.

NOTE: **This bulletin applies to vehicles built on or before February 28, 2017 (MDH 0228XX)****.**

SYMPTOM/CONDITION:

Customers may notice a smell in the passenger compartment while operating the vehicle in traffic conditions (Stop and Start, 2nd and 3rd gear and parking maneuvers).

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RRT VIN list, perform the Inspection Procedure. **This RRT only applies to vehicles on the RRT VIN list.**

PARTS REQUIRED:

Qty.	Part No.	Description
1	68398788AA	Seal
2	68248122AA	Tape

REPAIR PROCEDURE:

1. Open hood and locate the cowl seal gasket (Fig. 1) . Replace the gasket with the revised part listed in Parts Required. Verify seal makes contact to hood.

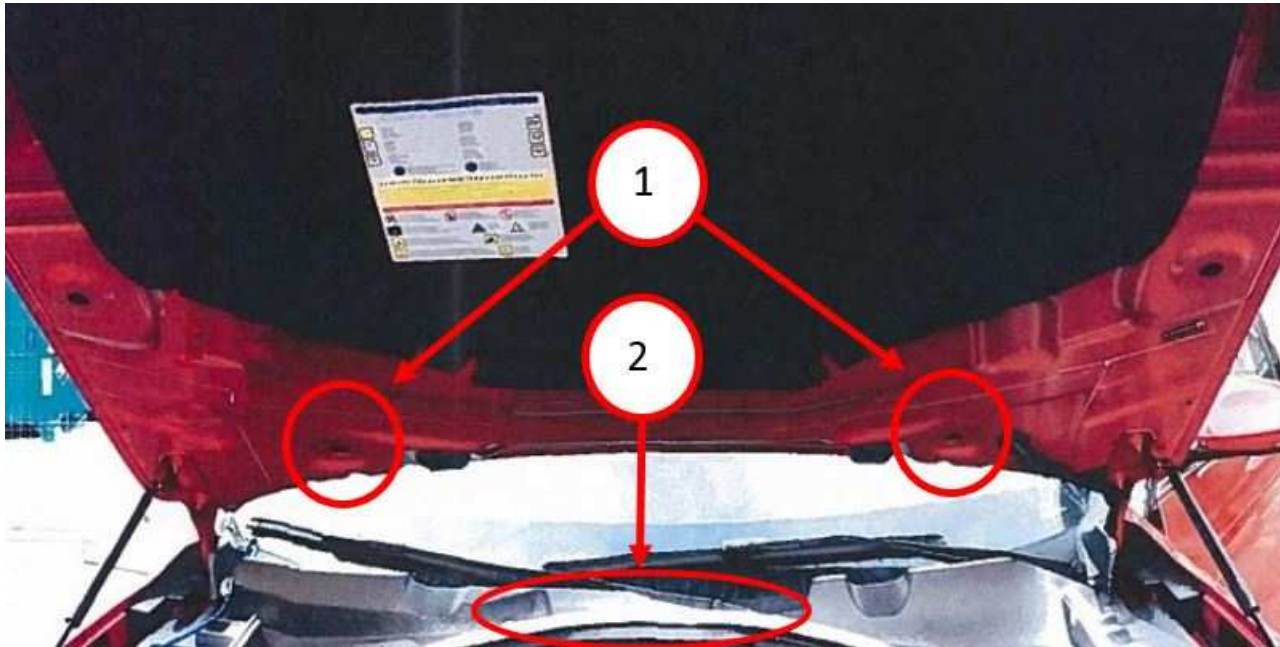


Fig. 1
Underhood View

- 1 - Vent Holes
2 - cowl Seal Gasket

2. Clean area around vent holes (Fig. 2) with isopropyl alcohol to allow insulating tape to stick to surface.

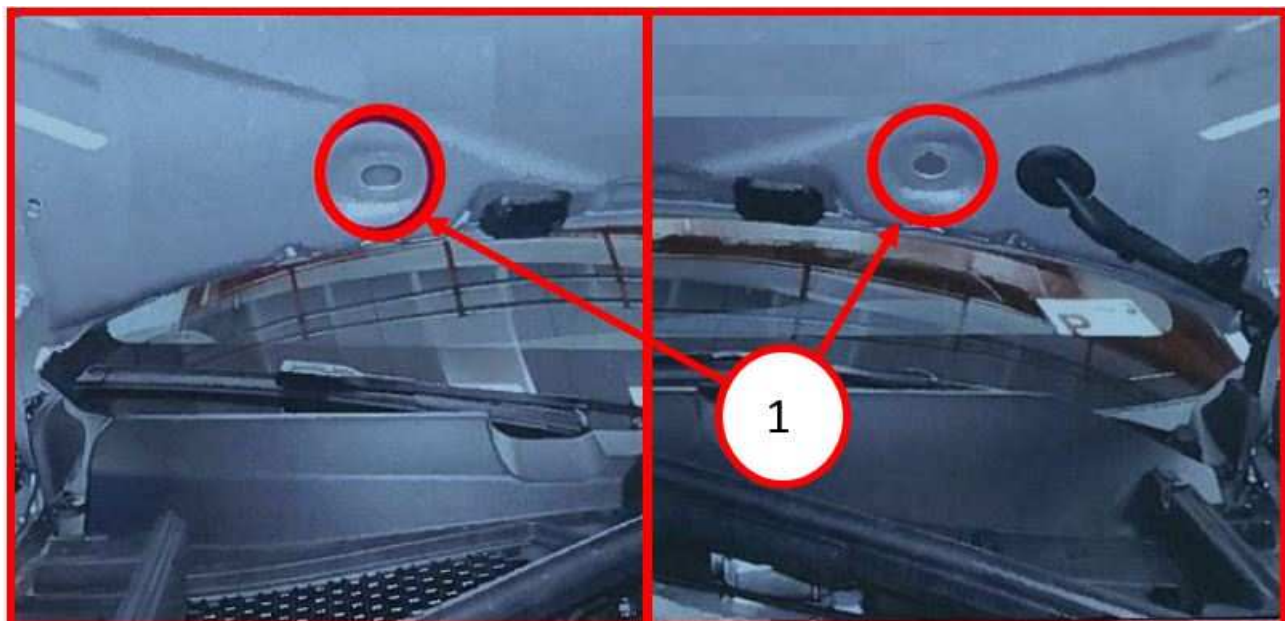


Fig. 2
Hood Vent Holes

- 1 - Vent Holes

3. Apply the insulating tape to cover vent holes.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
23-51-03-96	Replace Cowl Seal and Install Insulating Tape to Hood (1 - Semi-Skilled)	6 - Electrical and Body Systems	0.2 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------