

This Field Service Bulletin replaces bulletin "Unit Injector Yoke Hold-Down Bolt Torque Specification", (USA139451068) PV729-FSB237-020\_M, dated 09/2017.

Date	Group	No.	Release	Page
10.2017	<b>237</b>	<b>020</b>	<b>03</b>	1(2)

## Unit Injector Yoke Hold-Down Bolt Torque Specification CHU, CXU, GR, GU, PI


### FSB 237-020, Unit Injector Yoke Hold-Down Bolt Torque Specification

(October 2017)

MACK CHU, CXU, GR, GU, and PI trucks built from 2009 to 2017 and equipped with MP7, MP8, and MP10 engines (EM-USA10, EM-USA14, and EM-USA17), will require a new torque specification for the Unit Injector Yoke Hold-Down Bolt. Effective immediately, the torque value in step 4 has changed to 25 +5/-0 Nm (18 +4/-0 ft-lb). See the torque procedure in steps 1 through 5 below. Additionally, the new yoke hold-down bolt torque will be updated in all service procedures, methods, and specification manuals.

**Note:** If the unit injector yoke hold-down bolts are removed, do not reuse. The unit injector yoke hold-down bolts are made for one time use only.

**Note:** This bulletin does not apply to MACK Trucks Australia.

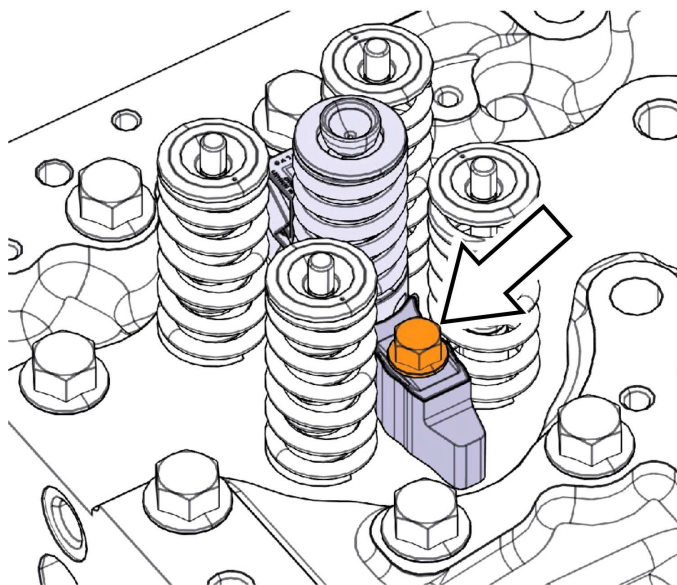

W2128267

### Unit Injector Yoke Hold-Down Bolt Torque Procedure

- 1 Tighten 20 +5 Nm (15 +4 ft-lb).
- 2 Tighten 180 ±5 degrees.
- 3 Loosen the bolt until the torque is 10 to 15 Nm (7 to 11 ft-lb), back off approximately 150 Degrees.
- 4 Tighten 25 +5/-0 Nm (18 +4/-0 ft-lb).

5 Tighten 90  $\pm$ 5 degrees.