



Preliminary Information

PIT5586 Diagnostic Tip - IPC Gauges Inoperative Or Fluctuate, No Crank, Start then Stall

Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2017	All	All	All	All
Chevrolet	Silverado	2017	All	All	All	All
Chevrolet	Suburban	2017	All	All	All	All
Chevrolet	Tahoe	2017	All	All	All	All
GMC	Sierra	2017	All	All	All	All
GMC	Yukon	2017	All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	
Condition	<p>Some owners may comment on any of the following issues below:</p> <ul style="list-style-type: none"> - IPC gauges inoperative or fluctuate - No Crank - No Start - Start then Stall - SIR Light / Service Airbag Message - Service Suspension Message - Radio display blank - Steering Wheel Controls (SWC) not illuminated - Turn Signal no audible feedback - HVAC controls inoperative - Any of the following DTC's: B1011, B1370, B3980, U0020, U0029, U007D, U0073, U0078, U0100, U0101, U0102, U0104, U0121, U0140, U0146, U0151, U0155, U0164, U0184, U0186, U0198, U0237, U0255, U0422
Cause	These concerns could be caused by the Serial Data Gateway Module (SDGM) X1 or X2 connector terminals being bent, backed out, or having loose terminal tension.

Correction:

Repair affected terminal(s) as needed.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

Version History

Version	1
Modified	

