



Preliminary Information

PIP5496A Fuel Tank Hard To Fill Possible MIL With DTC P0446


Proactive

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Equinox	2018	All	All	1.5L LYX and 2.0L LTG	All
GMC	Terrain	2018	All	All	1.5L LYX and 2.0L LTG	All
Involved Region or Country	North America					
Condition	Fuel tank hard to fill with fuel, evaporative emission canister saturated with fuel and possible DTC P0446					
Cause	Vent hose disconnected from fuel pump module assembly inside fuel tank					

Correction:

Reconnect fuel vent hose to fuel pump module inside fuel tank. Reference picture below showing properly connected fuel vent hose.

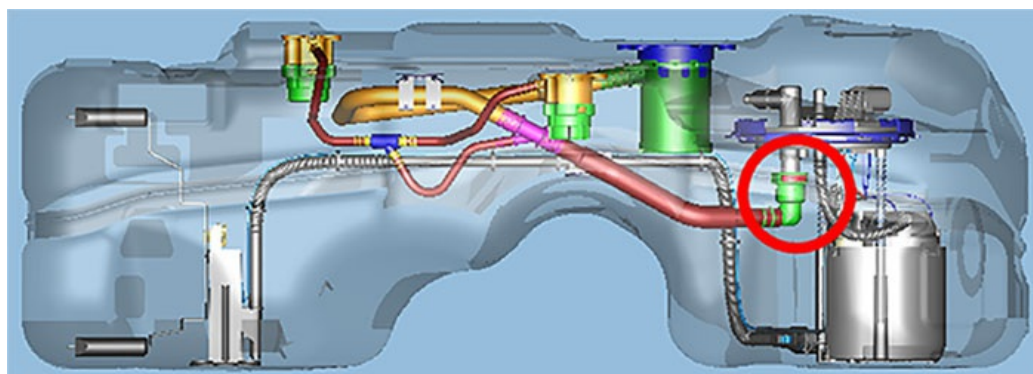

Also inspect evaporative emission canister for fuel saturation and replace canister as needed.

Warranty Information

Labor Operation	Description	Labor Time
4028730	Fuel Pump Module replacement	Use Published Labor Time
4027950	Evaporative Emission Canister Replacement	Use Published Labor Time

Version History

Version2	2
Modified	10/17/2017 Update to include 2018 GMC Terrain and 2.0 LTG

