



Preliminary Information

PIP5530 No Crank, No Start, DTC P0606 and/or Ten Or More ECM Related Codes Set

Proactive

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Malibu	2018	All	All	1.5 LFV	All
Involved Region or Country:	North America					
Additional RPO/s:	LFV					
Condition:	Crank no start or no crank condition with DTC P0606 and/or ten or more ECM related codes set.					
Cause:	Internal issue with E88 Engine Control Module					

Correction:

If you encounter a vehicle with the above condition then proceed with the following.

Verify the condition of the battery using the EL50313 Midtronics GR8 battery charger/tester and current service information.

Using GDS scan the ECM for diagnostic trouble codes.

If DTC P0606 is stored and/or 10 or more ECM related trouble codes are set, replace the Engine Control Module using latest parts available.

Note: This is a temporary repair and Engineering is working to root cause a permanent solution.

Warranty Information

Labor Operation:	Description:	Labor Time:
4025390	Engine Control Module Replacement	Use Published Labor Operation

Version History

Version	1
Modified	

