



GROUP  
BOD

MODEL  
2017MY  
Niro (DE)

NUMBER  
173

DATE  
October 2017


## TECHNICAL SERVICE BULLETIN

**SUBJECT:** OUTSIDE DOOR HANDLE COVER REPLACEMENT

This bulletin provides the procedure to replace all three (3) outside door handle covers (all except the front driver's door) on some 2017MY Niro (DE) vehicles produced from November 1, 2016 through April 12, 2017, which may exhibit separation of the outside door handle cover.

To correct this concern, replace the door handle covers as outlined in this bulletin.

**NOTE: Even if just one (1) door handle cover has separated, the dealer must order and replace all three (3) door handle covers at the same time (all except the front driver's door).**

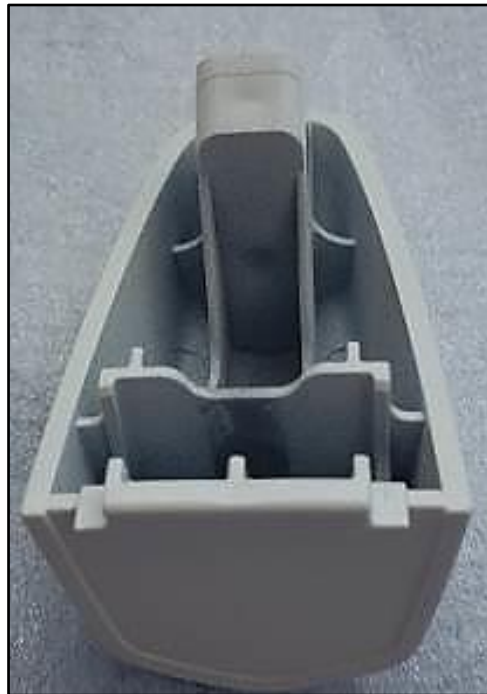

File Under: <Body>

Circulate To:  General Manager  Service Manager  Parts Manager  
 Service Advisors  Technicians  Body Shop Manager  Fleet Repair

**Replacement Procedure:**

1. Remove the front RH outside door handle cover by referring to “Body (Interior and Exterior) → Front Door → Front Door Outside Handle → Repair procedures” chapters in the applicable workshop manual.
2. Remove the rear LH/RH outside door handle covers by referring to “Body (Interior and Exterior) → Rear Door → Rear Door Outside Handle → Repair procedures” chapters in the applicable workshop manual.
3. Install the three (3) new outside door handle covers in the reverse order of removal (excluding the driver’s door).

**Tightening torque:****2.9 - 4.3 lb·ft (3.9 - 5.9 N·m, 0.4 - 0.6 kgf·m)****\* NOTICE****Do not over torque as this may damage the cover and cause separation.**




SUBJECT:

## OUTSIDE DOOR HANDLE COVER REPLACEMENT

AFFECTED VEHICLE RANGE:

Model	Production Date Range
Niro (DE)	November 1, 2016 through April 12, 2017

REQUIRED PART:

Part Name	Part Description		Qty.
	Previous	New	
Outside Door Handle Cover			
			
<b>Color</b>			
Silver White/White	82652 G5010SWP	82652 G5010SWPFF	3
Silky Silver/Silver	82652 G50104SS	82652 G50104SSFF	3
Aurora Black/Black	82652 G5010ABP	82652 G5010ABPFF	3
Crimson Red/Red	82652 G5010K3R	82652 G5010K3RFF	3
Gravity Blue/Blue	82652 G5010B4U	82652 G5010B4UFF	3
Metal Stream/Gray	82652 G5010MST	82652 G5010MSTFF	3
Deep Cerulean/Blue	82652 G5010C3U	82652 G5010C3UFF	3
Rich Espresso/Brown	82652 G5010DN9	82652 G5010DN9FF	3

WARRANTY INFORMATION:

N Code: A32 C Code: ZZ4

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
W	See Required Part Table (Page 3)	3	(BOD173) Outside Door Handle Cover Replacement (except LH front)	82652F03	0.3 M/H	See Required Part Table (Page 3)	3