

## **Preliminary Information**

PIT5595 Rear Vision or Surround Vision Camera Image Yellow, Blurry, Distorted, Scrolling, No Grid Lines, Blue Screen with Gridlines, Service Rear Vision System Message

## **Product Investigation Review Required**

## Models

				VIN:			
Brand:	Мо	del:	Model Years:	from to		- Engine:	Transmissions:
hevrolet	Traverse	9	2018	All	All	All	All
uick	Enclave		2018	All	All	All	All
			I	<u> </u>	<u> </u>	<u> </u>	1
volved Region or	Country	North Am	erica				
ivolved Region or		Some cus being: - Yellow - Blurry - Distorte - Image s - Image w - Screen i - Screen i	itomers may have a concer	sion Systen or without	n messa	nge	ound vision camera image

Condition		
Cause	These concerns could be caused by a poor connection in the camera sig (W/O UVH) The Std Rear Camera signal circuits 6972 and 6973 run betwee Camera) to the HMI bypass module K188 to the HMI module K74 For 360 c UVH) the Camera circuits 6972 and 6973 run between the rear camera B87 Module K157 to the HMI Bypass Module K188 to the HMI Module K74.	n Rear Camera B87 (Rear legre Camera system (RPO

Correction:  If, after performing normal SI diagnostics, the cause has not been found, resistance, poor terminal tension, bent terminals, etc. Replace and/or replace and/or replacessary.	
Warranty Information	
For wiring repairs covered under warranty, please refer to latest version of wire/connector repairs.	t bulletin 10-00-89-005 for warranty information on

 $For module \ replacement \ for \ bent \ pins \ covered \ under \ warranty, \ use \ the \ appropriate \ labor \ operation \ code.$ 

## **Version History**

Version	1
Modified	



















© 2016 General Motors. All Rights Reserved.