



Preliminary Information

PIT5596 Any Of The Following Fuses Blown F22PA F7UA F9UA F8UA F10UA F11UA F12UA F14UA F25UA F26UA F27UA F28UA F29UA F46UA F58UA F59UA F72UA and/or F75UA

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Express Van	2010 - 2017	All	All	All	All
GMC	Savana Van	2010 - 2017	All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	N/A
Condition	<p>Some customers may comment on any of the following issues listed below:</p> <ul style="list-style-type: none"> - No crank - No start - Service Charging System - Front or Rear park or turn signals inoperative - SIR MIL - IPC inoperative - ABS / TCS / Stability MIL - Trailer lighting inoperative - Windshield wiper washer pump inoperative - 110 volt inverter inoperative - Theft system indicator/message is illuminated - Dome lights inoperative - Back Up / Reverse lights inoperative - I/P dimming / back lighting inoperative <p>During diagnostics it may be found that one of the following fuses has blown:</p> <p>F22PA - Ign sw DLIS / PK3 F7UA - BCM 5 F8UA - BCM 7 F9UA - BCM 4 F10UA - IPC F11UA - TRLR WRG F12UA - Spare F14UA - Wash F25UA - Aux Pwr Outlet F26UA - BCM 3 F27UA - SEO F28UA - Airbag F29UA - STR/WHL/SNSR F46UA - AC/DC INV or Spare F58UA - BCM 2 F59UA - BCM 1 F72UA - BCM 6 F75UA - V6 Fuel Inj</p>
	<p>These concerns could be caused by the release cable for the parking brake pedal (1) cutting into the body harness (3) shorting the circuit to ground (2), as shown below.</p>

Cause

--

--

Correction:

To better inspect this area, the driver's knee bolster may need to be removed. Inspect the area near the parking brake pedal and parking brake pedal release cable for cutting into the body harness. If any damage is found, repair the area as needed and protect the harness to prevent this from happening again. We are currently looking into how and where this is happening in order to implement a corrective action plan.

Warranty Information

Please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

Additional SI Keywords

B1395 B1517 B1529 B3600 B3922 C0455 C0710

Version History

Version	1
Modified	



© 2016 General Motors. All Rights Reserved.