



Preliminary Information

PIT5598 Production and Service Part Change - Door Lock Switch Indicator

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2015	All	All	All	All
Involved Region or Country	North America					
Additional Options (RPO)						
Condition	<p>Some owners may comment that the red door lock indicator (1), located in the front driver or passenger door lock switches, is either missing or inoperative.</p> <div style="border: 1px solid black; height: 200px; width: 100%;"></div>					
Cause	<p>The red door lock indicator, shown above, was a redundant feature which turned on to indicate the doors are locked. Because it was a redundant feature the indicator was phased out of production. Along with the production change, the service replacement parts, which includes the door lock switches and door latches, have also phased out the feature.</p> <p>The production phase out is as follows:</p> <ul style="list-style-type: none"> -2015 Models withOUT RPO AVF, had the red door lock indicator in both front door lock switches. -2015 Models with RPO AVF built before December 2014, had the red door lock indicator only in the drivers front door lock switch. The red indicator in the passenger door lock switch was replaced with a trim colored insert, shown below. 					

-2015 Models with RPO AVF built after December 2014, future models and service replacement parts, had the red door lock indicator removed from both driver and passenger front door lock switches. The red indicator and trim colored inserts will be eliminated completely.

Correction:

None. This feature is being phased out, and if a door latch or door lock switch is replaced, the feature may no longer be active.

Version History

Version	1
Modified	



© 2016 General Motors. All Rights Reserved.