



Preliminary Information

PIT5599 History DTC U0121 Set In Front View Camera Module

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	LaCrosse	2017 - 2018	All	All	All	All
Cadillac	CT6	2016 - 2018	All	All	All	All
Cadillac	Escalade	2016 - 2018	All *See Note	All *See Note	All	All
Cadillac	XT5	2017 - 2018	All	All	All	All
Chevrolet	Bolt EV	2017 - 2018	All	All	All	All
Chevrolet	Malibu	2016 - 2018	All	All	All	All
Chevrolet	Silverado 1500	2016 - 2018	All	All	All	All
Chevrolet	Suburban	2016 - 2018	All	All	All	All
Chevrolet	Tahoe	2016 - 2018	All	All	All	All
GMC	Acadia (VIN N)	2017 - 2018	All	All	All	All
GMC	Sierra 1500	2016 - 2018	All	All	All	All
GMC	Yukon	2016 - 2018	All	All	All	All

* Only WithOUT RPO UGN On Escalade Models

Involved Region or Country	North America
Condition	When scanning for DTCs during diagnostic work, technicians may find a history code U0121 in the Front View Camera Module (FVCM).
Cause	Due to a FVCM software anomaly, DTC U0121 may set falsely in the FVCM. Code U0121 will set and transition to history status in the FVCM with each ignition cycle.

Correction:

Important: Do NOT reprogram or replace the FVCM for a history DTC U0121 set in the FVCM.

A FVCM DTC U0121, setting in history, without any other camera related symptoms, should NOT be diagnosed. If a technician attempts to diagnose a history DTC U0121 set in the FVCM, this will lead him down the wrong diagnostic path.

If DTC U0121 is set current, then refer to SI and perform normal diagnostics.

DTC U0121 setting in history in the FVCM without any other camera related symptoms is considered a phantom code – take no further action.

Additional SI Keywords

16-NA-177 16NA177

Version History

Version	1
Modified	

