LTB01077NAS1

TECHNICAL BULLETIN

07 JUL 2017



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

SECTION:

419-10: Multifunction Electronic Modules

SUBJECT/CONCERN:

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
Discovery (LR)	2017	000532-023790	Solihull
Range Rover Sport (LW)	2017	124031-157499	Solihull
Range Rover Sport (LW)	2017	666892-688634	Solihull
Range Rover (LG)	2017	320324-357266	Solihull

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:

SITUATION:

A 'Gearbox not in park' message may be displayed on the Instrument Cluster with the transmission in 'P' (PARK).

CAUSE:

This may be caused by a Body Control Module (BCM) software issue causing a false message to be displayed on the Instrument Cluster.

ACTION:

Should a Customer express this concern, follow the Diagnostic Procedure below.

PARTS:

No Parts Required

TOOLS: