

<b>Reference</b>	SSM73415
<b>Models</b>	Discovery / L462 Range Rover / L405 Range Rover Sport / L494
<b>Title</b>	DVD Disc Error displayed on Touch Screen (In Control Touch Pro only)
<b>Category</b>	Electrical
<b>Last modified</b>	31-Jul-2017 00:00:00
<b>Symptom</b>	207000 Entertainment Systems

**Content**

**Issue:** A customer may report a concern that after a DVD is inserted in the Optical Disc drive on vehicles manufactured with the In Control Touch Pro infotainment system the following message is shown intermittently: 'Disc error – Check disc is clean and inserted correctly'.

**Cause:** Infotainment Master Controller module software.

**Action:** For 17MY only using Pathfinder P93 or later loaded re-configure the existing 'Infotainment Master Controller'.

Select 'ECU Diagnostics'.

Select 'Infotainment Master Controller [IMC]'.

Select 'ECU Functions'

Select 'Update to Phase 3: InControl Touch Pro infotainment master controller.'

Technicians - Please rate this SSM and provide comments so that future communications can be improved.

1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.