

Reference	SSM73553
Models	Discovery / L462 Discovery Sport / L550 Range Rover / L405 Range Rover Evoque / L538 Range Rover Sport / L494 Range Rover Velar / L560
Title	Side Object Detection Modules false flagging DTC U3000-49
Category	Electrical
Last modified	11-Sep-2017 00:00:00
Symptom	206000 Warning Indicators
Content	<p><u>Issue</u></p> <p>At PDI or at normal service, the dealer may find DTC - U3000 - 49 Control Module internal electronic failure – recorded in the Side Object Detection Left (SODL) or Side Object Detection Right(SODR) without any customer impact on the Blind Spot Monitor features.</p> <p><u>Cause</u></p> <p>False flagging DTC due to Software issue.</p> <p><u>Action</u></p> <p>Please <u>DO NOT</u> replace the SODL/SODR module if this DTC U3000 – 49 is flagged. If there is no customer complaint (Blind Spot features working as intended) clear the DTC.</p> <p>If the customer reports (Blind Spot Monitor Not Available – message on the instrument cluster) re-flash both SODL and SODR modules to the latest software available.</p> <p>Technicians - Please rate this SSM and provide comments so that future communications can be improved.</p> <p>1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.</p> <p>3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.</p> <p>5 = Excellent – All required information provided to resolve the customer concern.</p>