

LTB00837NAS3



TECHNICAL BULLETIN

20 SEP 2017

© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

This reissue replaces all previous versions. Please destroy all previous versions.

Changes are highlighted in blue

SECTION:

307-01: Automatic Transmission/Transaxle

SUBJECT/CONCERN:

Transmission Cover Gasket Leak

AFFECTED VEHICLE RANGE:

| MODEL: | MODEL YEAR: | VIN: | ASSEMBLY PLANT: | APPLICABILITY: |
|-------------------------|--------------------|----------------|------------------------|---|
| Discovery Sport (LC) | 2015 Onwards | 500116 Onwards | Halewood | Vehicles With: 9HP48 9-Speed Automatic Transmission - AWD |
| Range Rover Evoque (LV) | 2014-2015 | 856580-999999 | Halewood | Vehicles With: 9HP48 9-Speed Automatic Transmission - AWD |
| Range Rover Evoque (LV) | 2015 Onwards | 000051 Onwards | Halewood | Vehicles With: 9HP48 9-Speed Automatic Transmission - AWD |

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:**SITUATION:**

A fluid leak from the transmission, poor shift quality, and/or transmission noise may be evident.

CAUSE:

This may be caused by the transmission cover gasket having been damaged during manufacture, allowing transmission fluid to leak.

ACTION:

Should a customer express this concern, follow the Service Instruction below.

PARTS:

| PART NUMBER | DESCRIPTION | QUANTITY: |
|--------------------|--------------------|------------------|
| | | |

| PART NUMBER | DESCRIPTION | QUANTITY: |
|-------------|----------------------------------|-----------|
| LR086413 | ZF Transmission cover gasket kit | 1 |
| LR023288 | ATF Transmission fluid | 1 |

TOOLS:



Jaguar Land
Rover-approved
Midtronics
battery power
supply



Jaguar Land
Rover-approved
diagnostic tool
with latest SDD
software,
Calibration File
(up to 2017MY)



Jaguar Land
Rover-approved
diagnostic tool
with latest
PATHFINDER
software (from
2018MY)

WARRANTY:

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.

- The JLR Claims Submission System requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero

| DESCRIPTION | SRO | TIME (HOURS) | CONDITION CODE | CAUSAL PART |
|--|----------|--------------|----------------|-------------|
| Transmission cover gasket - Renew | 44.20.28 | 0.7 | 42 | LR072666 |
| Lubrication system - Check and top up - GTDi 2.0L petrol | 44.24.06 | 0.7 | 42 | LR072666 |

NOTE:

Normal Warranty procedures apply.

SERVICE INSTRUCTION:

- 1 Install a new transmission cover gasket (see TOPIx Workshop Manual section 307-01: Automatic Transmission/Transaxle - Transmission Cover).
- 2 Check transmission fluid level (see TOPIx Workshop Manual section: 307-01 - Automatic Transmission/Transaxle - Transmission Fluid Level Check).
 - 1 Top up as required with ATF Transmission fluid (LR023288).