

LTB01086NAS1



TECHNICAL BULLETIN

14 SEP 2017

© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

SECTION:

501-14: Handles, Locks, Latches and Entry Systems

SUBJECT/CONCERN:

Keyless Entry System Lock Function May Not Operate and/or Operates Intermittently

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
Discovery Sport (LC)	2015 Onwards	501001 Onwards	Halewood
Discovery (LR)	2017 Onwards	025687 Onwards	Solihull
Range Rover Evoque (LV)	2012-2015	600018-999999	Halewood
Range Rover Evoque (LV)	2015 Onwards	000051 Onwards	Halewood
Range Rover Sport (LW)	2014 Onwards	601621 Onwards	Solihull
Range Rover (LG)	2013 Onwards	000140 Onwards	Solihull

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:

SITUATION:

The keyless entry system lock function may not operate or operates intermittently.

CAUSE:

This may be caused by water ingress into the exterior door handles preventing correct operation of the keyless entry lock function.

ACTION:

Should a customer express concern, follow the Workshop Procedure below.

PARTS:

NOTE:

It is not necessary to replace all door exterior handles; only order the quantity required per the customer concern.

PART NUMBER	DESCRIPTION	QUANTITY:
LR061200	Door handle - Exterior - Primed ('dimple' on handle)	1
LR040667	Door handle - Exterior - Primed ('stripes' on handle)	1
LR055917	Door handle - Exterior - Chrome - Aintree Green	1
LR075119	Door handle - Exterior - Chrome - Aruba Gold 1	1
LR055923	Door handle - Exterior - Chrome - Barolo Black	1
LR055907	Door handle - Exterior - Chrome - Barossa	1
LR076447	Door handle - Exterior - Chrome - Carpathian Grey	1
LR055904	Door handle - Exterior - Chrome - Causeway Grey	1
LR056188	Door handle - Exterior - Chrome - Corris Grey	1
LR055914	Door handle - Exterior - Chrome - Firenze Red	1
LR055921	Door handle - Exterior - Chrome - Fuji White	1
LR055911	Door handle - Exterior - Chrome - Havana	1
LR055920	Door handle - Exterior - Chrome - Indus Silver	1
LR055913	Door handle - Exterior - Chrome - Kaikoura Stone	1
LR046326	Door handle - Exterior - Chrome - Loire Blue	1
LR055903	Door handle - Exterior - Chrome - Luxor	1
LR055905	Door handle - Exterior - Chrome - Mariana Black	1
LR075120	Door handle - Exterior - Chrome - Montalcino Red	1
LR055906	Door handle - Exterior - Chrome - Nara Bronze	1
LR055916	Door handle - Exterior - Chrome - Santorini Black	1
LR067443	Door handle - Exterior - Chrome - Scotia Grey	1
LR072371	Door handle - Exterior - Chrome - Yulong White	1
LR013135	Clip - 8.5X0.8-2.2	12
LR044885	Clip - 8.2X1.2+2.5	1
LR006101	Clip - 8.2X0.7-1.5	10

PART NUMBER	DESCRIPTION	QUANTITY:
LR090382	Clip	4

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:

NOTE:

It is not necessary to replace all door exterior handles; only replace the quantity required per the customer concern.

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.
- The JLR Claims Submission System requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Handle - Exterior - Front door - Renew - Discovery Sport (L550)	76.58.07	0.7	49	LR061200
Handle - Exterior - Rear door - Renew - Discovery Sport (L550)	76.58.02	0.5	49	LR061200
Handle - Exterior - Front door - Renew - Discovery (L462)	76.58.08	0.9	49	LR061200
Handle - Exterior - Rear door - Renew - Discovery (L462)	76.58.02	0.6	49	LR061200

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Handle - Exterior - Front door - Renew - Range Rover Evoque (L538)	76.58.07	0.5	49	LR061200
Handle - Exterior - Rear door - Renew - Range Rover Evoque (L538)	76.58.02	0.4	49	LR061200
Handle - Exterior - Front door - Renew - Range Rover Sport (L494)	76.58.07	0.7	49	LR061200
Handle - Exterior - Rear door - Renew - Range Rover Sport (L494)	76.58.02	0.5	49	LR061200
Handle - Exterior - Front door - Renew - Range Rover (L405)	76.58.07	0.6	49	LR061200
Handle - Exterior - Rear door - Renew - Range Rover (L405; LWB)	76.58.02	0.9	49	LR061200
Handle - Exterior - Rear door - Renew - Range Rover (L405; SWB)	76.58.02	0.5	49	LR061200
Door handles - Each/set - Local color	79.E.AJ3	0.6	49	LR061200

NOTE:

Normal Warranty procedures apply.

WORKSHOP PROCEDURE:


If the customer concern relates to the exterior front (only) or front AND rear door handle(s) keyless entry system locking not operating as it should, go to Step 1.

If the customer concern relates to the exterior rear (only) door handle(s) keyless entry system locking not operating as it should, go to Step 2.

1

NOTE:


Driver door handle shown; passenger door handles similar.

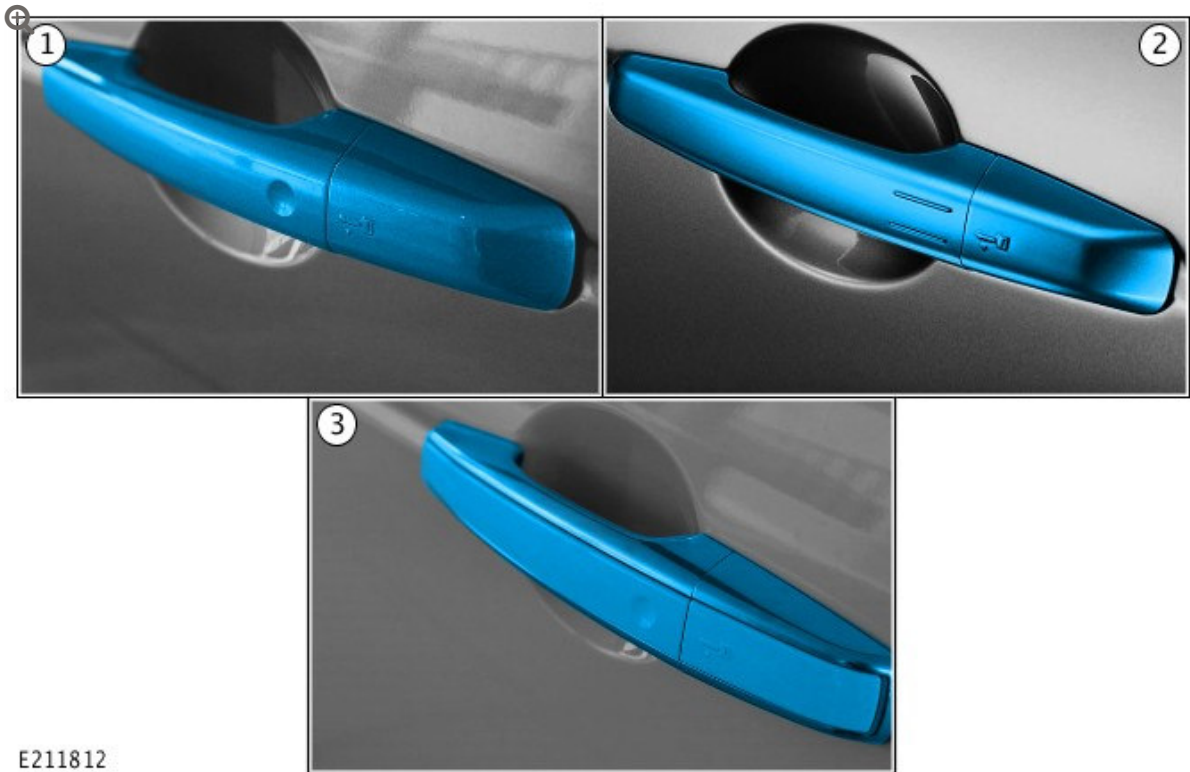

E211812

Refer to the illustration for the different handle types to make sure the correct replacement handle(s) is ordered for the vehicle.

- 1 'dimple' type handle (LR061200)
- 2 'stripe' type handle (LR040667)
- 3 'chrome' type handle (supplied by color)

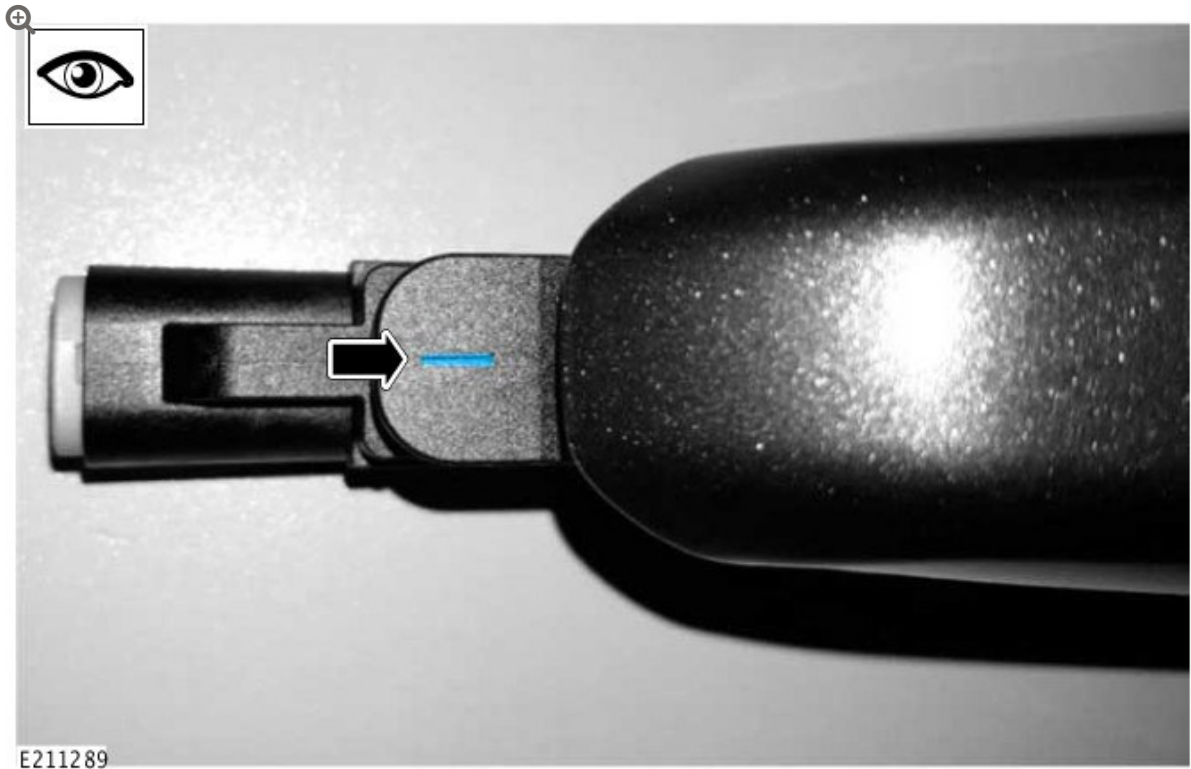

Inspect the new door exterior handle(s) for the identification mark.

3

NOTE:

If required: the exterior front door handle(s) must be painted before installation.

Replace the defective front exterior door handle(s) (see TOPIx Workshop Manual section 501-14: Exterior Front Door Handle).

4

NOTE:

If required: the exterior rear door handle(s) must be painted before installation.

Replace the defective rear exterior door handle(s) (see TOPIx Workshop Manual section 501-14: Exterior Rear Door Handle).