

Reference	SSM73441
Models	Discovery / L462 Range Rover / L405 Range Rover Sport / L494
Title	`Suspension fault` or `Adaptive dynamics fault` with U3000-04 stored in CHCM
Category	Chassis
Last modified	25-Sep-2017 00:00:00
Symptom	304000 Suspension System

Content

Issue: A customer may report that one or both of the messages "Suspension fault, Drive with care." or "Adaptive dynamics fault" are displayed intermittently on the Instrument Cluster. Following diagnosis using Pathfinder the Diagnostic Trouble Code (DTC) U3000-04 'Control Module System Internal Failure' is stored in the Chassis Control Module (CHCM). Concern applicable to 2017 MY vehicles only.

Cause: Software calibration.

Action: Using Pathfinder with software P105 or later loaded, re-configure the Chassis Control Module (CHCM). If the DTC returns, continue with diagnosis as guided by Pathfinder and with reference to TOPIx Workshop Manual.

Technicians - Please rate this SSM and provide comments so that future communications can be improved.

1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.