



Service Bulletin

File in Section: -

Bulletin No.: 17-NA-223

Date: July, 2017

TECHNICAL

Subject: ABS Light and/or Stabilitrak Light On - DTC C0035 and/or C0040 Set

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Equinox	2017	2017	December, 2016	June 5, 2017		
GMC	Terrain						

Involved Region or Country	North America, Middle East, Israel
Condition	Some customers may comment on one or more of the following conditions: <ul style="list-style-type: none">• ABS light on• Stabilitrak light on The technician may find one or more of the DTCs set: <ul style="list-style-type: none">• C0035• C0040
Cause	This condition may be caused by water intrusion into the left and/or right side wheel speed sensor.
Correction	Only replace the wheel speed sensor that has set any of the conditions listed.

Parts Information

Description	Part Number	Qty
SENSOR, FRT WHL SPD (R)	20811371	1
SENSOR, FRT WHL SPD (L)	20811372	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2410020	Front Wheel Speed Sensor Replacement	Use Published Labor Operation Time

Service Procedure

Refer to *Front Wheel Speed Sensor Replacement* in SI.

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION