



Date: Jul-2017

# **TECHNICAL**

Service Bulletin

Adaptive Cruise Control Inoperative and/or No Seat Belt Indicator for the Driver Seat, DTC Subject:

U0422:71 Set

| Brand:   | Model: | Model Year: |      | VIN: |    | Engine: | Transmission: |
|----------|--------|-------------|------|------|----|---------|---------------|
|          |        | from        | to   | from | to |         |               |
| Cadillac | XT5    | 2017        | 2017 |      |    |         |               |
| GMC      | Acadia | 2017        | 2017 |      |    |         |               |

| Involved Region or Country | North America and N.A. Export Regions  |  |  |
|----------------------------|--|--|--|
| Additional Options (RPOs)  | Equipped with CRUISE CONTROL-AUTOMATIC, ADAPTIVE, WITH STOP/GO (KSG)   |  |  |
| Condition                  | Some customers may comment on the adaptive cruise control being inoperative and/or no seat belt indicator for the driver seat. Upon investigation, the technician may find DTC U0422:71 set. |  |  |
| Cause                      | This condition may be caused when the seat belt buckle switch wiring pigtail is pinched between the buckle and buckle mounting bracket.  |  |  |
| Correction                 | Replace the driver side seat buckle.   |  |  |

#### **Service Procedure**

Refer to Front Seat Belt Buckle Replacement in SI.

#### **Parts Information**

Refer to the electronic parts catalog (EPC) for obtaining the P/N for the driver side seat buckle.

### **Warranty Information**

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

| Labor Operation | Description                        | Labor Time                            |
|-----------------|------------------------------------|---------------------------------------|
| 6440020         | Front Seat Belt Buckle Replacement | Use Published Labor Operation<br>Time |

| Version | 1 |
|---------|---|
| version | I |
|         |   |
|         |   |

## Modified

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION