



GROUP
Electrical

MODEL
**2018MY
Rio (SC)**

NUMBER
PS529

DATE
November 2017



TECHNICAL OPERATIONS

SUBJECT: TPMS AND/OR TRUNK OPEN LAMP ON DURING PDI

This Pitstop contains information regarding the TPMS lamp ON and Trunk Open warning lamp ON, or Master Warning Mode lamp ON in the cluster during PDI, even while the trunk is closed. This condition may be caused by the Transportation Fuse being in the OFF position.

The 2018 MY Rio (SC), unlike other Kia models, does not have a "FUSE ON" reminder in the instrument cluster if the transportation fuse is OFF.

Verify that the transportation fuse is ON (this can be done by ensuring the yellow transportation fuse tab holder is fully pressed into the In-Panel Junction Box, located in the lower driver's side crash pad) and that neither the AUDIO (A) nor ROOM (B) fuses are blown.



Type A cluster.



Type B cluster.

