

GROUP	MODEL
TRA	2018MY
	Optima (JFa) 2.0T
	Sorento (UMa) 3.3L
NUMBED	
NUMBER	DATE

TECHNICAL SERVICE BULLETIN

SUBJECT:

SERVICE ACTION: SHIFT QUALITY LOGIC

IMPROVEMENT (SA315A)

This bulletin provides the procedure to improve the logic of the Transmission Control Unit (TCU) on some 2018MY Optima (JFa) 2.0T, produced from April 19, 2017 through July 10, 2017, and some 2018MY Sorento (UMa) 3.3L vehicles, produced from March 31, 2017 through July 25, 2017, which may experience a shift quality concern, such as a hard downshift, upshift, and/or shift delay. To correct this concern, apply the improved logic to the TCU using the KDS ECU Upgrade function as described in this bulletin. For confirmation that the latest reflash has been applied to a vehicle you are working on, verify the ROM ID using the table on pages 2-3 of this bulletin. Kia is requesting the completion of this Service Action on all affected vehicles in dealer stock, prior to delivery. Before conducting the procedure, verify that the vehicle is included in the list of affected VINs.



Kia Diagnostic System (KDS)

* NOTICE

A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Repair status for a VIN is provided on WebDCS (Service \rightarrow Warranty Coverage \rightarrow Warranty Coverage Inquiry \rightarrow Campaign Information). Not completed Recall / Service Action reports are available on WebDCS (Consumer Affairs \rightarrow Not Completed Recall \rightarrow Recall VIN \rightarrow Select Report), which includes a list of affected vehicles.

This issue number is SA315A.

File Under: <Transmission>

☑ Service Advisors ☑ Technicians ☑ Body Shop Manager ☐ Fleet Repair

ECU Upgrade Procedure:

To correct this condition, the ECU should be reprogrammed using the KDS download, as described in this bulletin.

Upgrade Event Name
351.JFA 2.0/2.4 TCU GEAR SHIFT LOGIC IMPROVEMENT
354.UMA 3.3 TCU GEAR SHIFT LOGIC IMPROVEMENT

* NOTICE

- A fully charged battery is necessary before ECU upgrade can take place. It is recommended that the Midtronics GR8-1299 system be used in ECU mode during charging. DO NOT connect any other battery charger to the vehicle during ECU upgrade.
- All ECU upgrades must be done with the ignition key in the 'ON' position.
- Be careful not to disconnect the VCI-II connected to the vehicle during the ECU upgrade procedure.
- DO NOT start the engine during ECU upgrade.
- DO NOT turn the ignition key 'OFF' or interrupt the power supply during ECU upgrade.
- When the ECU upgrade is completed, turn the ignition 'OFF' and wait 10 seconds before starting the engine.
- ONLY use approved ECU upgrade software designated for the correct model, year.

* NOTICE

Before attempting an ECU upgrade on any Kia model, make sure to first determine whether the particular model is equipped with an immobilizer security system. Failure to follow proper procedures may cause the PCM to become inoperative after the upgrade and any claims associated with this repair may be subject to chargeback.

ROM ID INFORMATION TABLE:

Upgrade Event #351

Madal	EM	TNA	TCU D/No	ROM ID		
Model EM		TM	TCU P/No.	Previous	New	
JFa	2.0T	АТ	39108-2GTK2 39108-2GTK7	TJF0T20NSB TJF0T20NSC	TJF0T20NSD	

Upgrade Event ##354

Model	ЕМ	ТМ	TM	TM	TCU P/No.	ROM ID	
Wodei	Model EM III		TCU P/NO.	Previous	New		
UMa	3.3L	АТ	39111-3CWN2 39101-3CWN2	TUM0Z33NS8	TUM0Z33N*****\$9		

To verify the vehicle is affected, be sure to check the Calibration Identification of the vehicle's ECM ROM ID and reference the Information Table as necessary.

* NOTICE

Prior to performing the ECU upgrade, be sure to check that the KDS is fully charged.

1. Connect the VCI-II to the OBD-II connector, located under the driver's side of the instrument panel.

* NOTICE


The ECU upgrade function on KDS operates wirelessly. It is not necessary to perform the upgrade via USB cable.

With the ignition ON, turn ON the KDS tablet. Select KDS from the home screen.






3. Confirm communication with VCI (A) and then configure the vehicle (B) using the **AUTO VIN** (C) feature.

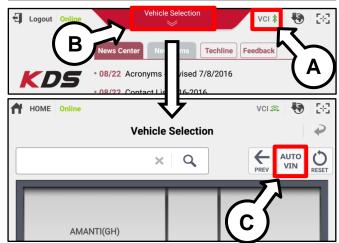

4. Select **ECU Upgrade**.

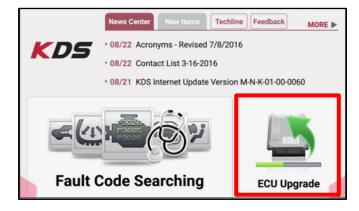

5. The KDS will check the server for recently uploaded Events and then automatically download **Upgrade Event** #351 or #354.

* NOTICE

The vehicle must be identified in Vehicle Selection to download an Event for that vehicle.

After the download is complete, the program will shut down to install.

Please wait until the program restarts.

Event

Status

271.QF 2.4GDI DTC P0171,P0420 LOGIC IMPROVEMENT

Downloading

273.TF 2.4GDI DTC P0171,P0420 LOGIC IMPROVEMENT

Peady

Do not touch any system buttons while performing this function.

KDS screenshot shown above is for demonstration purposes only. Events shown in screenshot are not applicable to this bulletin.

Select Auto Mode.




Do NOT attempt to perform a Manual Mode upgrade <u>UNLESS</u> <u>Auto Mode fails</u>. Always follow the instructions given on the KDS in either Auto or Manual mode.

Select the A/T system under the System selection menu.

Touch **ID Check** (D) and confirm that the latest update is available.

Select **Upgrade Event #351 or #354** and select **Upgrade** to continue.

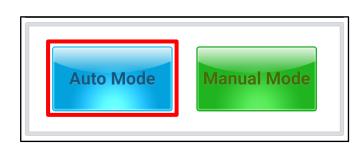




 The ECU upgrade will begin and the progress of the upgrade will appear on the bar graph. Upgrade part (1/2) (E) will download the upgrade event to the VCI-II. Upgrade part (2/2) (F) will upgrade the ECU.



Do not touch the system buttons (like 'Back', 'Home', 'etc.') while performing ECU Upgrade.

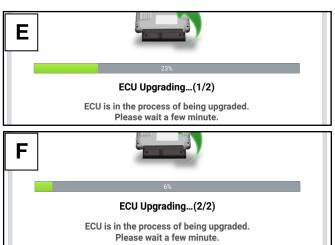


 If a "Communication Fail" screen appears, verify that the VCI-II and KDS are communicating properly. Touch OK and restart the procedure from step 4.

* NOTICE


If an error notice continues to appear or if the upgrade cannot be performed, contact Techline or GIT America Help Desk.

10. When instructed on the KDS, turn the ignition **OFF** for ten (10) seconds then back on. Touch **OK** to continue.



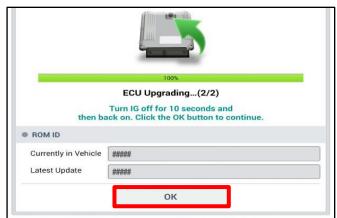

11. Once the upgrade is complete, touch **OK** to finalize the procedure.

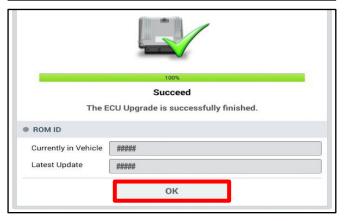

12. When prompted, select YES to check for Diagnostic Trouble Codes (DTC) and erase any DTCs stored such as EPS, ESC, and TPMS that may have been set during the upgrade.



13. Start the engine to confirm proper operation of the vehicle.

Manual Upgrade Procedure:

* NOTICE

The manual upgrade should ONLY be performed if the automatic upgrade fails.

If the automatic upgrade fails, turn the ignition OFF for about 10 seconds then place it back in the ON position to reset the control unit BEFORE performing manual upgrade.

See table below for Manual Mode passwords.

Manual Mode ECU Upgrade Passwords

Event	Model	System	Menu	Password
351	JFa 2.0T	TCU	JFA 2.0TGDI ULEV : 39108-2GTK2/K7	8229
354	UMa 3.3L		UMA 3.3GDI : 39111/39101-3CWN2	0131

- 1. Within the ECU Upgrade screen displayed, select **Manual Mode**.
- 2. Select the **AT** system under the System selection menu. Select **Upgrade Event #351 or #354** and select **Upgrade** to continue.
- 3. Select the appropriate control unit part number with reference to the ROM ID Information Table on page 3, and select **OK**.
- 4. Enter the appropriate password from the Manual Mode password table above and select **OK**.
- 5. The upgrade will begin and the progress of the upgrade will appear on the bar graph.
- 6. When instructed on the KDS, turn the ignition **OFF** for ten (10) seconds then back on. Touch **OK** to continue.
- 7. Once the upgrade is complete, touch **OK** to finalize the procedure.
- 8. When prompted, select **YES** to check for Diagnostic Trouble Codes (DTC) and erase any DTCs stored such as EPS, ESC, and TPMS that may have been set during the upgrade.
- 9. Start the engine to confirm proper operation of the vehicle.

AFFECTED VEHICLE RANGE:

Model	Production Date Range		
Optima (JFa) 2.0T	April 19, 2017 through July 10, 2017		
Sorento (UMa) 3.3L	March 31, 2017 through July 25, 2017		

WARRANTY INFORMATION:

N Code: N99 C Code: C99

Model	Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
JFa 2.0T	V	39100	0	(SA315A)	47045000	0.3	N/A	
UMa 3.3L	- V	2GTC8	0	2.0T & 3.3L TCU Logic Improvement	170A52R0	M/H	IV/A	0

* NOTICE

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference <u>SA315A</u> when accessing the WebDCS system.