



Bulletin No.: PIP5539
Published date: N/A

Preliminary Information

PIP5539 MIL On DTC P0299

 
Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Malibu	2016 - 2018	All	All	1.5L (LFV)	All

Involved Region or Country	North America
Condition	MIL on - P0299.
Cause	Broken wastegate actuator rod.

Correction:

If the turbocharger wastegate actuator rod is found to be broken, the wastegate actuator assembly can be replaced as a separate component.



Complete turbocharger replacement for this issue is not recommended.

When replacing the wastegate actuator assembly, install the spring washer as directed by TSB 17-NA-007.

Version History

Version	1
	Created on 12/20/2017.



© 2016 General Motors. All Rights Reserved.