

GROUP	NUMBER	
CAMPAIGN	17-01-072	
DATE	MODEL(S)	
DECEMBER, 2017	GENESIS (BH) EQUUS (VI)	

SUBJECT:

2009-2014 GENESIS (BH) AND 2011-2016 EQUUS (VI) ANCHOR PRETENSIONER LABEL INSTALLATION (SERVICE CAMPAIGN T2R)

* IMPORTANT

*** Retail Vehicles ***

Dealers must perform this Service Campaign on all affected vehicles whenever an affected vehicle is in the shop for any maintenance or repair.


When a vehicle arrives at the Service Department, access Hyundai Motor America's "Warranty Vehicle Information" screen via WEBDCS to identify open Campaigns.

* IMPORTANT

For Genesis (BH) vehicles, please use the same labels as used on Recalls 160/169. For Equus (VI) vehicles, please use labels only provided for Service Campaign T2R.

Description: The front seat belt assembly incorporates a seat belt anchor pretensioner fastened to the vehicle's front seat frame. During vehicle assembly, the anchor pretensioner is fastened to the front seat frame prior to being connected to the seat belt linkage. If, during vehicle repair, the connector does not fully latch when the linkage was pressed onto the connector, the seat belt can detach from the anchor pretensioner. If the seat belt linkage detaches from the anchor pretensioner in a collision, the risk of injury to the occupant is increased.

This bulletin describes the procedure to install warning labels on the driver's and/or passenger's seat belt assemblies to prevent potential improper reattachment of the anchor pretensioners.

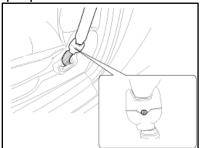

NOTICE

Please note this is a simple installation that can be performed in the dealer's service drive in less than 5 minutes.

Applicable Vehicles:

2009-2014MY Genesis (BH) vehicles

2011-2016MY Equus (VI) vehicles

Parts Information:

Genesis (BH): Driver side ONLY

Part Name	Part Imaga	Part Number		Remarks	
Fait Naille	Part Image	Previous	New	Remarks	
Warning Label, Anchor Pre-Tensioner	LOCKED LOCKED LOCKED ALIGN LOCK NUT SLOT WITH ARROWS TO PREVENT SEATBELT DETACHMENT	N/A	20114-1882R	1 label needed per Genesis (BH) vehicle	

Note: For Genesis (BH), each dealer was provided one roll of 1000 labels for Recall 160 & Recall 169 which can also be used for Service Campaign T2R. Additional rolls of 1000 labels can be ordered through your facing PDC.

Equus (VI): Driver & Passenger sides

Part Name	Part Image	Part Number		Remarks	
Fait Name	Fait illiage	Previous	New	Nemains	
Warning Label, Anchor Pre-Tensioner RH&LH	WARNING LOCKED ALIGN LOCK NUT SLOT WITH ARROWS TO PREVENT SEATBELT DETACHMENT LH WARNING WARNING LOCKED LOCKED ALIGN LOCK NUT SLOT WITH ARROWS TO PREVENT SEATBELT DETACHMENT	N/A	20114-1883R	1 set of LH & RH labels needed per Equus (VI) vehicle	

Note: For Equus (VI), each dealer will initially be provided one sheet that contains 12 sets of LH & RH labels. Additional sheets of 12 sets of LH & RH labels can be ordered through your facing PDC.

Warranty Information:

Model	Op Code	Operation	Op Time	Causal Part	Nature Code	Causal Code
Genesis (BH) Equus (VI)	70C117R0	Anchor Pretensioner Label Installation	0.2 M/H	11251-06161	192	ZZ6

NOTES:

- Submit Claim on Campaign Claim Entry Screen
- If a part is found in need of replacement while performing Service Campaign T2R and the affected
 part is still under warranty, submit a separate warranty claim using the same repair order. If the
 affected part is out of warranty, submit a Prior Approval Request for goodwill consideration prior to
 performing the work.

TSB #: 17-01-072 Page 2 of 4


Service Procedure:

1. Locate the driver anchor pretensioner (A) near the lower B pillar trim (B) and move the front seat appropriately to easily access the anchor pretensioner.



2. Visually inspect the inboard surface of the linkage element (C) and make sure the surface is free from any debris.

Note: if necessary, wipe the surface with a clean, dry cloth.

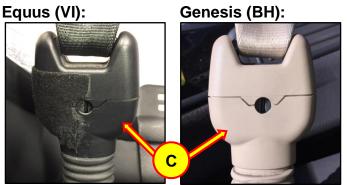

TSB #: 17-01-072 Page 3 of 4


SUBJECT: ANCHOR PRETENSIONER LABEL INSTALLATION (SERVICE CAMPAIGN T2R)

3. Peel off the label (D) and align it with the center hole (E) and top horizontal line (F) of the linkage element.

NOTICE

NOTE: For Genesis (BH), the anchor pretensioner is located on the driver side ONLY.

Equus (VI): Genesis (BH): !\ WARNING \(\alpha \) **⚠ WARNING WARNING** LOCKED LOCKED 4 LOCKED ALIGN LOCK NUT SLOT WITH ARROWS TO PREVENT SEATBELT DETACHMENT

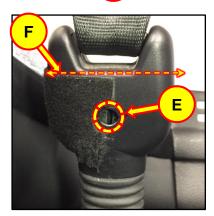

4. Firmly press down on the label to ensure it **Equus (VI)**: adheres to the surface of the linkage element.

> Note: Green "LOCKED" arrows (G) should align with the latch slot.





5. For **Equus (VI)**, locate the passenger's anchor pretensioner and move the passenger seat appropriately, and repeat Steps 2 through 4 to install the RH label (H).

Equus (VI):



TSB #: 17-01-072 Page 4 of 4