



# Parts Bulletin

TITLE:

**Recall R89716: Replace 3rd Row Passenger Side Seatbelt Retractor  
Model Year 2017, XC90 with 7 Seats**

<b>GROUP:</b> 8	<b>CAT/NO:</b> R89716	<b>REFERENCE BULLETINS:</b> TJ 32813, QB R89716	<b>CAR MARKET:</b> United States and Canada	
<b>COPY TO / CIRCULATIONS (PLEASE INITIAL):</b>			<b>ISSUE DATE:</b> 2017-06-08	<b>STATUS DATE:</b> 2017-06-08
<b>GENERAL MANAGER</b>	<b>PARTS MANAGER</b>	<b>SERVICE MANAGER</b>	<b>SALES MANAGER</b>	
				<b>Page 1 of 1</b>

**“Right first time in Time”**

**Reference Bulletins: TJ 32813, QB R89716**

Volvo Car USA LLC and Volvo Car Canada LTD (Volvo) on behalf of Volvo Car Group has decided to launch Recall R89716 on certain model year 2017 XC90 vehicles with 7 seats.

The crimping of the tube for the Micro Gas Generator (MGG) in the 3rd row passengers side seat belt retractor, was not manufactured to specification. In the event of a crash where the pre-tensioner is activated and in combination with certain conditions, the MGG squib may detach and be propelled out of the tube. If the MGG squib penetrates the inner side trim panel, it will lose most of its kinetic energy before it may enter the 3rd row occupant compartment. Despite this condition, the seat belt functions properly.

The corrective action is to replace the 3rd row passenger’s side seatbelt retractor.

A total of 1,305 U.S. and 101 Canadian vehicles are eligible for this recall.

The following part numbers apply:

Part Number	Description	Qty
39842894	3rd Row seatbelt retractor (blond)	1
39825742	3rd Row seatbelt retractor (charcoal)	1

**No replacement parts are available at this time. We will update this bulletin as soon as replacement parts information is available.**