

## Vibration in Front Seats, Floor, and Accelerator Pedal at Highway Speeds

### AFFECTED VEHICLES

2015–16 TLX V6 with AWD

**EDITOR'S NOTE:** This article replaces the one posted in **June 2017** to extend the article's shelf life. The issue(s) covered are still being addressed.

Are you feeling a vertical vibration in the front seats, the floor, and the accelerator pedal that starts as early as **50 mph**, progressively gets worse as speed increases, then peaks around **70 to 75 mph**?

To cut down on this vibration, replace the tires with this **new** part number:

| Description         | Tire Size     | Part Number   |
|---------------------|---------------|---------------|
| Goodyear Eagle LS-2 | 225/50R18 95H | 42751-GYR-051 |

This tire is available through our Tire Rack program and is now the **new** original equipment spec tire.

If tire replacement reduces the vibration, you're done. But if that vibration is unchanged or it stays at an unacceptable level after replacement, then continue with normal troubleshooting.