



TECHNICAL SERVICE BULLETIN

Pickup Only - 6.7L - Illuminated MIL With Diagnostic Trouble Codes (DTCs) P2201, P2459, P2463 And/Or P246C

17-2234
09 November
2017

This bulletin supersedes 17-0021. Reason for update: New Part/Procedure For Same Condition

Model:

Ford 2015-2016 Super Duty

Summary

This article supersedes TSB 17-0021 to update the Service Procedure.

Issue: Some 2015-2016 F-Super Duty pickup vehicles equipped with a 6.7L engine may exhibit an illuminated malfunction indicator lamp (MIL) with DTCs P2201, P2459, P2463 and/or P246C.

Action: Reprogram the powertrain control module (PCM) to the latest calibration using Integrated Diagnostic System (IDS) or Ford J2534 Diagnostic Software (FJDS) release 106.01 or higher. Make sure you are connected to the internet when entering module programming to obtain the latest updates. Calibration files may also be obtained at www.motorcraftservice.com.

Warranty Status: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

Labor Times

Description	Operation No.	Time
2015-2016 F-Super Duty 6.7L: Retrieve DTCs And Reprogram The PCM (Do Not Use With Any Other Labor Operations)	172234A	0.4

Repair/Claim Coding

Causal Part:	RECALEM
Condition Code:	04

Service Procedure

NOTE: ADVISE THE CUSTOMER THAT THIS VEHICLE IS EQUIPPED WITH AN ADAPTIVE TRANSMISSION SHIFT STRATEGY WHICH ALLOWS THE VEHICLE'S COMPUTER TO LEARN THE TRANSMISSION'S UNIQUE PARAMETERS AND IMPROVE SHIFT QUALITY. WHEN THE ADAPTIVE STRATEGY IS RESET, THE COMPUTER WILL BEGIN A RE-LEARNING PROCESS. THIS RE-LEARNING PROCESS MAY RESULT IN FIRMER THAN NORMAL UPSHIFTS AND DOWNSHIFTS FOR SEVERAL DAYS.

© 2017 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.