

SSM 46901	<p>Some 2017-2018 Fusion/MKZ vehicles built on or before 27-Oct-2017 may exhibit an illuminated airbag lamp and/or SYNC 911 assist not operational message being displayed. Connect the IDS and check the RCM and APIM for DTCs. If any of the following RCM DTCs U3000, U2100, U2101, U2300, U0455, B0080, B141B, B141C, B0054, B140C, B140D, B0057, B140E, B140F and/or APIM DTC U0452 is stored, then reprogram the RCM to the latest level using IDS or FJDS 107.04 or higher. After reprogramming, perform an as-built configuration of the RCM. Make sure you are connected to the internet when entering module programming to obtain the latest updates. For claiming, use causal part 14B321 and applicable labor operations in section 10 of the service labor time standards (SLTS) manual. Calibration files may also be obtained at www.motorcraftservice.com</p>
--------------	---