

SSM 46903	When replacing a 2015-2018 Transit 3.2L Duratorq-TDCi engine assembly or block, two new transmission locator dowel pins (W703519 or W718670) must be installed. This information is available in Workshop Manual, Section 303-01C. The parts catalog also specifies to order the dowels when ordering an engine. Failure to install dowels pins will prevent proper engine to transmission alignment resulting in a cracked flexplate and/or crankshaft position sensor damage. Per Warranty and Policy, damage resulting from an incomplete or improper repair is not warrantable.
--------------	---