

SSM 46945	Some 2017 Continental vehicles built on or before 31-May-2017 may exhibit a steering wheel that does not move far enough when entering or exiting the vehicle. Reprogram the body control module B (BCMB) using Integrated Diagnostic System (IDS) or Ford J2534 Diagnostic Software (FJDS) release 105.04 or higher. After reprogramming, perform an as-built configuration of the BCMB. Make sure you are connected to the internet when entering module programming to obtain the latest updates. Calibration files may also be obtained at www.motorcraftservice.com . For claiming, use causal part 14B561 and applicable labor operations in section 10 of the service labor time standards (SLTS) manual.
--------------	---