



# Technical Service Bulletin

## 91 RMC: MMI display missing all text

91 17 30 2043595/3 June 7, 2017. Supersedes Technical Service Bulletin Group 91 number 16-89 dated November 14, 2016 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6	2014 - 2017	All	Radio low- NAR
Q3	2015 - 2017	All	Radio low- NAR

## Condition

Revision Table		
Revision	Date	Purpose
3	-	Revised <i>Service</i> (Added New SVM Code for MY16-17 and added download option for software) Revised <i>Parts &amp; Tools</i> (Added New SD card Part Number)
2	11/14/2016	Revised <i>Service</i> (Added software update)
1	03/07/2016	Initial publication

- The customer states that the display on the MMI screen is incomplete and text is missing (Figure 1 and Figure 2).
- Additionally, the cluster DIS text may be using an incorrect menu language.



Figure 1. MMI car menu missing text.



# Technical Service Bulletin

---



*Figure 2. MMI main menu missing text.*

## Technical Background

The RMC main unit is designed to support French, Spanish, and English languages. The control module software has an issue that can cause the system language to default to German. Because German is not contained in the software, the condition occurs.

## Production Solution

New software introduced into series production.

## Service

Verify that the MMI menus can be changed by selecting the telephone, radio, or media buttons.

If the MMI freezes and does not respond when MMI menu change is attempted:

- Contact TAC.
- If the menus change, then a hardware replacement is not needed. Perform a software update listed below:
- Update the RMC MMI software and complete the SVM code at the end of the process to code and parameterize the main unit and to provide feedback documentation to SVM. This process will also clear "Checking SVM DTC" if successful.

### Required equipment:

- ODIS Tester
- SVM code listed in steps below.



# Technical Service Bulletin

---

- RMC Software Update on SD Card (See required parts & tools information table below)

OR

- RMC Software downloaded onto an SD Card using the SD Creator\*
- \*For more information about the SD creator, see TSB 2047812, *00 SD Creator: How to setup and use the SD Creator for obtaining vehicle software updates via the MirrorServer*

### Time to complete update:

- Approximately 60 minutes (includes SW update and SVM work).

### Repair procedure:

1. Determine which SD card is required based on the table below:

Model & Model Year	SD Card Part Number
2015 Q3 2012-2015 A6	8X0 906 961 P
2016-2017 Q3 2016-2017 A6	8X0 906 961 AE

2. Connect a charger or battery maintainer to the vehicle that capable of maintaining the vehicle voltage at the appropriate levels (check current capacity of maintainer). Turn off all unnecessary battery consumers, such as LED DRL's, HVAC blower, Radio volume mute, etc.).
3. Follow the steps listed in the attached document "RMC\_Software\_Update.PDF" to complete the update process. Enter the Red Engineering Update menu using the procedure listed in the instructions. Do not use the White Customer Update menu found under *Menu >> Settings*. Performing the update in the White Customer Update menu will only update the Bluetooth firmware and nothing else. Please perform the full update in the Red Engineering Update menu.
4. Perform the SVM feedback documentation using the SVM code listed below:

Model	RMC Update	SVM Code
2015 Q3 2012-2015 A6	RMC_NAR_K16158	RMC16NAR
2016-2017 Q3 2016-2017 A6	RMC_NAR_K16342	RMC19NAR



# Technical Service Bulletin

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"><li>• 110 up to 48 months/50,000 miles.</li><li>• G10 for CPO Covered Vehicles - Verify Owner.</li><li>• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li></ul>		
<b>Service Number:</b>	9196		
<b>Damage Code:</b>	0040		
<b>Labor Operations:</b>	Program infotainment control module	9196 9999	70 TU
<b>Diagnostic Time:</b>	GFF	0150 0000	Time stated on diagnostic protocol (Max 100 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
<b>Claim Comment:</b>	As per TSB #2043595/3		


All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Required Parts and Tools

Part Number	Part Description	Quantity
8X0906961P	RMC Software Update SD card (2012-2015 A6 or 2015 Q3)	1 (per dealer)
8X0906961AE	RMC Software Update SD card (2016-2017 A6/Q3)	1 (per dealer)

## Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

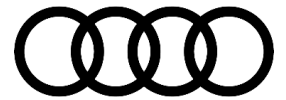

# Technical Service Bulletin

---

- TSB 2047812, 00 SD Creator: How to setup and use the SD Creator for obtaining vehicle software updates via the MirrorServer.

All parts and service references provided in this TSB (2043595) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

©2017 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.