



Technical Service Bulletin

94 Warning Message in Cluster Driver information System "exterior lighting system error"

94 17 90 2048429/1 July 27, 2017.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3	2015	All	Not Applicable

Condition

Customer states:

Sporadically there is a warning message in the cluster DIS of "exterior lighting system error", but there are no visible issues with the exterior lighting system.

Workshop findings:

- The customer concern may or may not be able to be reproduced.
- No DTC(s) are logged in the vehicle electrical system control module, J519 (address word 0009).



Tip: This TSB only affects early pull-ahead MY2015 cars with PR code "S0B".

Technical Background

The internal check at vehicle startup is not completed correctly and intermittently the warning message is seen.

Production Solution

Introduction of improved software into series production.



Technical Service Bulletin

Service

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions.*
2. Update the vehicle electrical system control module, J519 (address word 0009) using the SVM action code as listed in the table below, if necessary:

Model	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code
2015 A3	5Q0937085S	0124	5Q0937085AB	0137	09A015
	5Q0937085AB	0134	5Q0937085AB	0137	

3. Verify the lighting system functions properly after the update is completed.

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9710		
Damage Code:	0039		
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 150 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2048429/1		



Technical Service Bulletin

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions*.

All parts and service references provided in this TSB (2048429) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

©2017 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.