

Technical Service Bulletin

91 Parking aid system does not work (DTC 1549, 1626, 1627, 1628, and/or 1629)

91 17 19 2023006/4 March 30, 2017. Supersedes Technical Service Bulletin Group 91 number 14-31 dated April 7, 2014 for reasons listed below.

| | Model(s) | Year | VIN Range | Vehicle-Specific Equipment |
|---|----------|-------------|-----------|----------------------------|
| Ē | Q5 | 2009 - 2017 | All | Front parking aid |

Condition

| REVISION HISTORY | | | | | |
|------------------|------------|--|--|--|--|
| Revision | Date | Purpose | | | |
| 4 | - | Revised header data (Added model year 2017) | | | |
| 3 | 04/07/2017 | Revised title Revised header data (Added model years 2014 - 2016; added DTCs) | | | |
| 2 | 08/22/2011 | Revised header data (Added model years 2012 and 2013) | | | |

• The parking aid system does not work.

One or more of the following DTCs may be logged in parking aid control module, J446 (address word 0010), for disruption/short circuit to ground:

- DTC 1549 (Supply voltage for parking aid sensor)
- DTC 1626 (Right front parking aid sensor)
- DTC 1627 (Right front center parking aid sensor)
- DTC 1628 (Left front center parking aid sensor)
- DTC 1629 (Left front parking aid sensor)

© 2017 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Technical Service Bulletin

Technical Background

The wire harness for the parking aid system may have been damaged when the front license plate frame was installed (Figure 1).



Figure 1. Damage to the wire harness for the parking aid system.

Production Solution

Not applicable.

Service

Repair the wire harness as necessary.

Warranty

This damage is due to outside influence and is not covered by any Audi Warranty.

^{© 2017} Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Technical Service Bulletin

Additional Information

All parts and service references provided in this TSB (2023006) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

©2017 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.

© 2017 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.