



Technical Service Bulletin

01 Oil pressure warning in DIS (DTC P164D00)

01 17 09 2041093/5 April 14, 2017. Supersedes Technical Service Bulletin Group 01 number 16-57 dated April 11, 2016 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, A7	2016	000001 - 108668	3.0 TFSI (EVO)
A8	2015	All	3.0 TFSI (EVO)
A8	2016	000001 - 012861	3.0 TFSI (EVO)
Q7	2017	000001 - 002942	3.0 TFSI (EVO)

Condition

REVISION HISTORY		
Revision	Date	Purpose
5	-	Revised <i>Warranty</i> (Updated Damage Code and Claim Type)
4	04/11/2016	Revised header data (Added Q7)
3	03/07/2016	Completely revised

The following DTC is stored in the engine control module (ECM), J623 (address word 0001):

- **DTC P164D00** (Oil pressure switch for reduced oil pressure malfunction)

One or both of the following warnings may be displayed in the DIS:

- The red oil pressure warning light.
- An oil warning: "shut vehicle off".

Technical Background

Rubber oil drain plug within the oil filter housing is out of position or has insufficient pre-tension.

Technical Service Bulletin

Production Solution

Improved rubber plug and spring.

Service

Before proceeding, confirm the condition:

- If the red oil pressure warning light is not on and DTC cannot be reproduced, replace the rubber plug and spring (Figure 1).
- If the red oil pressure warning light is on and DTC can be reproduced, perform oil pressure test as instructed by GFF (with engine oil temperature at 80°C):
- If oil pressure is above 0.7 bar after test, replace the rubber plug and spring (Figure 1), then re-check oil pressure (with engine oil temperature at 80°C). The oil pressure must be above 1.4 bar at idle. If it is not, contact TAC.
- If oil pressure is below 0.7 bar after test, contact TAC.



Figure 1. Rubber plug with spring.

Warranty

Claim Type:	<ul style="list-style-type: none"> • 110 up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If vehicle is outside any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	1733		
Damage Code:	0012		
Labor Operations:	Oil pressure check (if required)	1703 0108	120 TU (For A6,A7,A8)



Technical Service Bulletin

			80 TU (For Q7)
	Replace plug with spring (if required)	1733 1999	20 TU
Diagnostic Time:	GFF – Checking and clearing fault codes	0150 0000	20 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2041093/5		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Part Number	Part Description	Quantity
06E115489	Spring	1
06E115475	Rubber plug	1

Additional Information

All parts and service references provided in this TSB (2041093) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

©2017 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.