



Technical Service Bulletin

34 Warning message in DIS "Vehicle Electronics Malfunction" (DTC B116229)

34 17 20 2047609/1 April 25, 2017.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3	2015	All	Not Applicable

Condition

Customer may report:

- Warning message in driver information display stating "Vehicle Electronics Malfunction"

Workshop Findings:

- **DTC B116229** (Selector lever park position lock switch implausible signal) stored in the steering wheel electronics module, J527 (address word 0016)

Technical Background

Supplier assembly issue in the gear selector control module.

Production Solution

Improved assembly of parts.

Service

If the customer has the above condition and the DTC B116229 is stored in the steering wheel electronics module, J527 (address word 0016) replace the shift mechanism and recheck for proper operation.



Technical Service Bulletin

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	3410		
Damage Code:	0015		
Labor Operations:	Quattro: Gearshift lever housing remove + reinstall	3410 1906	370 TU
	Front Wheel Drive: Gearshift lever housing remove + reinstall	3410 1903	220 TU
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 50 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2047609/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Part Number	Part Description	Quantity
8V1 713 023 (*)	Shift Mechanism	1

* The ending suffix depends on the model and production date of the vehicle. The part needs to be ordered to the VIN of the vehicle in from ETKA



Technical Service Bulletin

Additional Information

All parts and service references provided in this TSB (2047609) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

©2017 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.