

## **Technical Journal**

TITLE:

## Oil leakage from plug in VVT pulley

REF NO: TJ 29131.7.0	ISSUING DEPARTMENT: Technical Service		ARKET: s and Canada
3 US 7	PARTNER: '510 Volvo Car USA	ISSUE DATE: 2017-10-16	STATUS DATE: 2017-10-19
FUNC GROUP: 2150	FUNC DESC: Transmission	Page	1 of 8

"Right first time in Time"

### **Attachment**

File Name	File Size
TJ29131-1.jpg	0.2297 MB
TJ29131-2.jpg	0.0285 MB
TJ29131-3.jpg	0.0800 MB
TJI-475358-1_1_2_en-US.pdf	1.0995 MB

### **Vehicle Type**

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
138	40	B4204T11					2016-2018	36	0097323-9999999	201535-201718
156	40	B4204T11					2016-2018	36	0834791-9999999	201535-201718
1XX	26						2014-2017	21	-	201346-201633
1XX	26						2014-2017	22	-	201346-201633
1XX	27						2014-2017	21	-	201346-201633
1XX	40						2014-2017	21	-	201346-201633
1XX	40						2014-2017	22	-	201346-201633
1XX	49						2014-2017	21	-	201346-201633
1XX	49						2014-2017	22	-	201346-201633
256	A2	B4204T27					2016-2017	21	0000001-9999999	201505-201633
256	BC	B1BPHEV					2016-2017		-	201526-201633

## **Technical Journal 29131.7.0**



### **CSC** Customer Symptom Codes

Code	Description
BU	Lubrication and oil system/Incorrect fluid level
Ј9	Lubrication and oil system/Oil leakage

### **VST** Operation Number

VST Operation Number	Description
36050-2	Calibrating/Identifying with VIDA
98533-2	Plug VVT-Units,inc. camshaft belt and cleaning acc. to TJ29131
98532-2	Plug VVT-units replace acc. to TJ29131

### **DTC** Diagnostic Trouble Codes

Rows beginning with \* are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

#### **Text**

#### **DESCRIPTION:**

\*Updated structure week range for all vehicle type + engines.

Customer may experience a low oil level warning in DIM and /or oil leakage from the engine.

The oil may leak due to a crack in the plug from the VVT pulley (see attached photo).

### **SERVICE:**

Replace both plugs in both VVT-pulleys according to the attached instruction. Plug PN: 31375877 If the timing belt is effected with oil, replace the timing belt according to VIDA instructions.

### **VEHICLE REPORT:**

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 2150.

To view TJ attachment continue to next page. This TJ has three attachments.

Page 2 of 8 2017-10-19



## **Technical Journal 29131.7.0**





2017-10-19 Page 3 of 8

## **Technical Journal 29131.7.0**





Page 4 of 8 2017-10-19

# Volvo Car Customer Service TJ Instruction VCC-475358-1

Title	Plug VVT unit	Page	1 (4)
Action	Product fix	Operation number:	98532-2
			98533-2
			36050-2

Issue	Date	Reason
1	2014-06	First issue
2	2016-08	Change in Affected Vehicles

### **Affected vehicles**

Model year	Model	Engine
2014, 2015,	S60 (11-)	B4204T11, T12, T19, T9
2016		
2016	S60L	B4204T11, T19
2014, 2015	S80 (07-)	B4204T11, T12
2014, 2015,	V60	B4204T11, T12, T19, T9
2016		
2014, 2015	V70 (08-)	B4204T11
2014, 2015	XC60	B4204T11, T12, T9
2014, 2015	XC70 (08-)	B4204T11
2016	XC90 (16-)	B4204T27

### **Materials**

Materials	Qty.	Part No.	Notes
Plug	2.0	31375877	
Engine oil	0.5	31392923	(CN only 933382831);

#### Removal

Note! Removal steps in this procedure may	
contain installation details.	

### Remove right front wheel, refer to:

Removal, replacement and installation

7 - Springs and wheels

77 - Wheels, tyres, hubs

771 - wheel and wheel trim

### Remove engine pad right, refer to:

Removal, replacement and installation

2 - Engine with mountings and equipment

21 - Engine

218 - engine mounting


### Remove the auxiliaries belt, refer to:

Removal, replacement and installation

2 - Engine with mountings and equipment

21 - Engine

215 - transmission

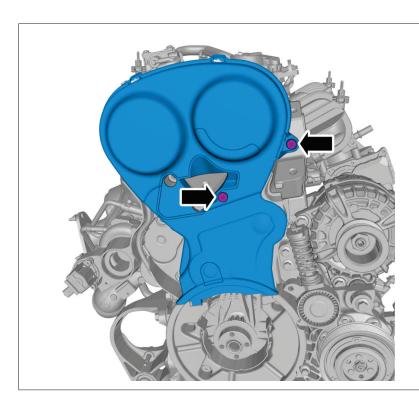


Remove the screws.


### Torque:

M6, 10 Nm

TJ Instruction VCC-475358-1 Page 3 ( 4 )

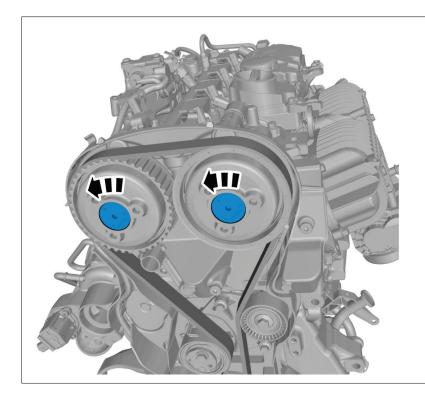


Warning! Be prepared to collect escaping fluid.

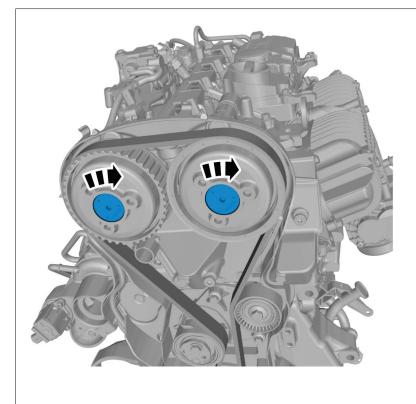

### Torque:

Plug VVT unit, 5 Nm

TJ Instruction VCC-475358-1 Page 4 ( 4 )

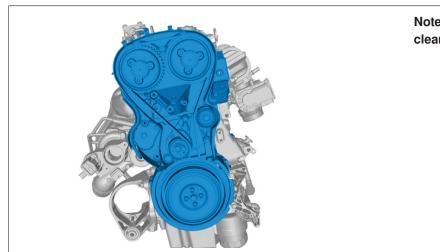

Note! Make sure that the component is clean, free of foreign material and lubricant.

### Installation

To install, reverse the removal procedure.
Check the oil level according to: VIDA/
DIAGNOSTICS/VEHICLE COMMUNICATION/
ECM/Advanced/General/Miscellaneous