Service Update

31170 Rear Suspension Shackle Bolt Contacts HVAC Line



Reference Number: N16203117 Release Date: January 2017

Revision: 01

Revision Description: This bulletin is being revised to update the labor times within the Warranty Information

section. Please discard all previous copies of bulletin 31170.

Attention: This service update includes vehicles in dealer inventory and customer vehicles that return to the

dealership for any reason. This bulletin will expire at the end of the involved vehicle's New Vehicle Limited

Warranty period.

		Model Year				
Make	Model	From	То	RPO	Description	
Chevrolet	Express	2015	2016	C36	Auxiliary Heater	
GMC	Savana	2015	2016	C69	HVAC System Rr-Air Conditioner	

Involved vehicles are marked "open" on the Investigate Vehicle History screen in GM Global Warranty Management system. This site should always be checked to confirm vehicle involvement prior to beginning any required inspections and/or repairs.

Condition	Certain 2015 and 2016 model year Chevrolet Express and GMC Savana vehicles, equipped with HVAC system rear - air conditioner (RPO C69) or auxiliary heater (RPO C36), may have contact between the rear leaf spring shackle bolt and rear HVAC coolant lines that may rub through creating a coolant leak.
	This leak may cause the engine to overheat, leading to loss of propulsion or loss of HVAC performance.
Correction	Replace the shackle bolt. Inspect and, if necessary, replace the auxiliary heater hose.

Parts

Quantity	Part Name	Part No.	
1	Rear Spring Rear Bolt	11588857	
1 (If Req'd)	Auxiliary Air Conditioning Evaporator Hose	23172815	
1 (If Req'd)	Auxiliary Air Conditioning Evaporator Hose	23172814	
1 (If Req'd)	Auxiliary Heater Inlet and Outlet Hose	20970677	
1 (If Req'd)	Auxiliary Heater Inlet and Outlet Hose	20970676	
1 (If Req'd)	Engine Coolant	12346290(US)	
		10953464	
		(Canada)	

Note: Use the VIN and the GM Electronic Parts Catalog (EPC) to determine which hose to order.

Warranty Information

Labor Operation	Description	Labor Time	Trans. Type	Net Item
9102597	Replace Rear Spring Rear Bolt	0.4	ZFAT	N/A
	Add: Auxiliary Air Conditioning Evaporator Tube with Auxiliary Heater Inlet and Outlet Pipe Replacement	3.9*		

^{*} Includes time for draining and filling cooling system and to recover and recharge R-134a A/C System.

Service Update

31170 Rear Suspension Shackle Bolt Contacts HVAC Line



Service Procedure

- 1. Raise and support the vehicle. Refer to Lifting and Jacking the Vehicle in SI.
- 2. Remove the left rear tire. Refer to Tire and Wheel Removal and Installation in SI.
- 3. Support the rear axle independently in order to relieve the tension on the leaf springs.



4593753

- 4. Remove the spring shackle to leaf spring mounting bolt (1) and DISCARD.
- 5. Install a NEW spring shackle to leaf spring mounting bolt.
- 6. Tighten the spring shackle to leaf spring mounting nut.

6.1. First Pass: 100 Nm (74 lb ft)6.2. Final Pass: (210 degrees)

7. Remove the support.





4593757

Note: If there are any signs of damage to the auxiliary heater hose or evidence of the auxiliary heater hose contacting the spring shackle to leaf spring mounting bolt, the auxiliary heater hose MUST be replaced.

Service Update

31170 Rear Suspension Shackle Bolt Contacts HVAC Line



- Inspect the auxiliary heater hose for any signs of damage or evidence of the auxiliary heater hose contacting the spring shackle to leaf spring mounting bolt.
 - If there are NOT any signs of damage to the auxiliary heater hose or evidence of the auxiliary heater hose contacting the spring shackle to leaf spring mounting bolt, no further action is required.
 - If there are any signs of damage to the auxiliary heater hose or evidence of the auxiliary heater hose contacting
 the spring shackle to leaf spring mounting bolt, replace the auxiliary air conditioning evaporator hose or auxiliary
 heater inlet and outlet hose depending on vehicle content. Refer to Auxiliary Air Conditioning Evaporator Hose
 Replacement (Rear) in SI.
- 9. Install the left rear tire. Refer to Tire and Wheel Removal and Installation in SI.
- 10. Lower the vehicle. Refer to Lifting and Jacking the Vehicle in SI.

Dealer Responsibility

Whenever a vehicle subject to this service update enters your vehicle inventory, or is in your facility for service in the future, and the vehicle is still covered under the New Vehicle Limited Warranty, you must take the steps necessary to be sure the service update correction has been made before selling or releasing the vehicle.

All new, used, GM Certified Used, courtesy transportation vehicles, dealer shuttle vehicles, etc. in dealers' possession and subject to this bulletin <u>must</u> be held and inspected/repaired per the service procedure of this bulletin <u>before</u> customers take possession of these vehicles. Involved vehicles must be held and not delivered to customers, dealer-traded, released to auction, used for demonstration, or any other purpose.

All GM Certified Used vehicles currently in the dealers' inventory within the Certified Pre-Owned Inventory System (CPOIS) will be de-certified and must be held and remedied per the service procedure in this bulletin. Upon submitting an accepted/paid warranty transaction in the Global Warranty Management (GWM) system, the vehicle can be re-certified for sale within the CPOIS system, or once again be used in the CTP program.

GLOBAL SAFETY FIELD INVESTIGATIONS DCS4312 URGENT - DISTRIBUTE IMMEDIATELY

Date: January 17, 2017

Subject: 31170 - Service Update

Rear Suspension Shackle Bolt Contacts HVAC Line

Revised Warranty Information section

Models: 2015-2016 Chevrolet Express

2015-2016 GMC Savana

Equipped with Auxiliary Heater (RPO C36) or HVAC System Rear-Air

Conditioner (RPO C69)

To: All General Motors Dealers

This bulletin is being revised to update the labor times within the Warranty Information section. Please discard all previous copies of bulletin 31170.

END OF MESSAGE GLOBAL SAFETY FIELD INVESTIGATIONS