



<b>Countries:</b>	CANADA, UNITED STATES, MEXICO	<b>Document ID:</b>	IK0400152
<b>Availability:</b>	ISIS, NotSIR	<b>Revision:</b>	3
<b>Major System:</b>	BRAKES	<b>Created:</b>	8/28/2017
<b>Current Language:</b>	English	<b>Last Modified:</b>	9/5/2017
<b>Other Languages:</b>	NONE	<b>Author:</b>	William Katschke
<b>Viewed:</b>	201		

[Less Info](#)

Hide Details

Coding Information

<b>Copy Link</b> 	<b>Copy Relative Link</b> 	<b>Bookmark</b>  <a href="#">View My Bookmarks</a>	<b>Add to Favorites</b> 	<b>Print</b> 	<b>Provide Feedback</b> 	<b>Helpful</b>  5	<b>Not Helpful</b>  0
----------------------	-------------------------------	--	-----------------------------	------------------	-----------------------------	-------------------------	-----------------------------

**Title: Windshield Replacement on trucks equipped with Lane Departure Cameras**

**Applies To: RH, LT and Medium Duty with one of the following feature codes 008TTG, 0008TPU, 0008TTT, 0008TTU**

## CHANGE LOG

Please refer to the change log text box below for recent changes to this article:

09/05/2017 - Corrected a typo 09/01/2017 - Revised applies to, added links to supplier sites and patch for Bendix fault. 08/31/2017 - Initial Article Release
---

## DESCRIPTION

This document will inform the user of required steps to take when the windshield is replaced on a truck with Bendix Fusion or Meritor LDW.

## SYMPTOM(s)

Windshield has been replaced

DTC/Light	Description
N/A	N/A

## SPECIAL TOOL(s) / SOFTWARE

Not Applicable

Tool Description	Tool Number	Comments	Instructions
N/A	N/A	N/A	N/A

---

**SERVICE PARTS INFORMATION**

Kit Description	Part Number	Quantity Required	Notes
SUPPORT, BRACKET ASSY, FUSION	2515172C91	1	Bendix Fusion / Order from PDC
SUPPORT SAFA TRAK3 LDW CAMERA	3710193C1	1	Meritor LDW / Order from PDC

---

**DIAGNOSTIC STEP(s)**

Not Applicable

---

**REPAIR STEP(s)**

 <b>WARNING:</b>
To prevent property damage, personal injury and/or death, park vehicle on a hard, flat surface, turn the engine off, set the parking brake, and install wheel chocks to prevent the vehicle from moving in either direction.

 <b>WARNING:</b>
To prevent property damage, personal injury and/or death, if the vehicle must be raised, do not work under the vehicle supported only by jacks. Jacks can slip or fall over.

 <b>WARNING:</b>
To prevent personal injury and/or death, always wear safe eye protection when performing vehicle maintenance.

 <b>WARNING:</b>
To prevent property damage, personal injury and/or death, keep flames or sparks away from vehicle and do not smoke while servicing the vehicle's batteries. Batteries expel explosive gases.

 <b>WARNING:</b>
To prevent property damage, personal injury and/or death, remove the ground cable from the negative terminal of the battery box before disconnecting any electrical components. Always connect the ground cable last.

- 1. If replacing the windshield on a truck equipped with Bendix Fusion or Meritor Lane Departure Warning the module mounting bracket must be replaced.
  - Bendix Fusion Bracket part number: 2515172C91
  - Meritor LDW Bracket part number: 3710193C1

<b>Note:</b>
Double sided tape does not have sufficient strength to hold the bracket to the windshield.

- 2. Replacement procedures:
  - Bendix Fusion: [SD-64-20124 Bendix™ AutoVue® FLC20™ Camera](#)
  - Meritor LDW: [Lane Departure Warning System](#)

- IKNow Articles for diagnostic and installation information:
- Bendix: [IK0400080](#)
  - Meritor: [IK1300094](#)

For Bendix Fusion if fault code 1703-31 (with sub-fault clarification in ACOM = DTC 60 Image Processor Calibration error) is present apply the patch below:

- Download the [patch](#)> Unzip the patch once downloaded> Click correct Interface device> follow prompts to completion

## **WARRANTY INFORMATION**

### **Warranty Claim Coding:**

<b>Group:</b>	08928
<b>Noun:</b>	284

### **Warranty Claim Coding:**


Refer to the [Warranty Coding Manual](#) for Group and Noun Codes.

### **Standard Repair Time(s):**

Refer to the [SRT Manual](#) for Repair Times

## **OTHER RESOURCES**

[Master Service Information Site](#)

	Hide Details	<b>Feedback Information</b> Viewed: 200 Helpful: 5 Not Helpful: 0
<div style="border: 1px solid #ccc; padding: 5px; min-height: 20px;">                     No Feedback Found                 </div>		

Copyright © 2017 Navistar, Inc.