ATTENTION:

GENERAL MANAGER PARTS MANAGER CLAIMS PERSONNEL SERVICE MANAGER

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.



© 2017 Subaru of America, Inc. All rights reserved.



QUALITY DRIVEN SERVICE


SERVICE INFORMATION BULLETIN

APPLICABILITY: 2015-2018MY Legacy Models NUMBER: 12-230-17

SUBJECT: Trunk Garnish Installation Precautions DATE: 9/15/17

INTRODUCTION:

This Service Information bulletin provides precautions to use when installing the trunk garnish panel located between the combination lamps. If the garnish is not installed properly, the small rubber protector(s) at the bottom edges of the garnish may become displaced and possibly allow the panel to contact / scratch the painted surface of the trunk. Over time, the finish may abrade through to bare metal and potentially allow rust to develop.

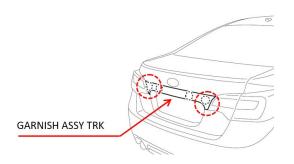



SERVICE PROCEDURE / INFORMATION:

Should the need arise to remove and / or replace the trunk garnish, review the illustrations below first then confirm the following:

• The small rubber protectors on each lower end of the garnish must be in their proper positions. If not, CAREFULLY peel (they are self-adhesive) and reapply as necessary for proper positioning.

Continued...

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.


Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

SUBARU OF AMERICA, INC. IS ISO 14001 COMPLIANT


ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

Bulletin Number: 12-230-17; Date 9/15/17

• Install the garnish by aligning the retaining clips then pushing forward and at a slightly upward angle at the same time. Pushing the garnish straight ahead may dislodge the protectors and allow the panel to contact the trunk lid. Undamaged retaining clips are reusable.

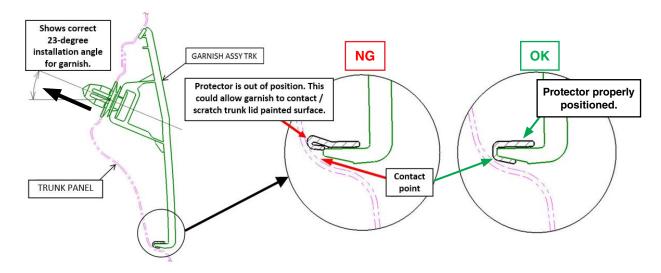

• Use the photos below to confirm both protectors are in place after the garnish is fully seated.

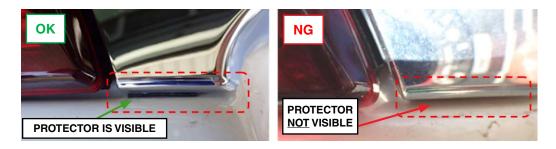

IMPORTANT REMINDERS:

- SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.
- Always check for any open recalls or campaigns anytime a vehicle is in for servicing.
- Always refer to STIS for the latest service information before performing any repairs.