

1 01 24-17



Service Information Bulletin

| SUBJECT | DATE |
|---------------------------------|--------------|
| SPN 3720/FMI 14 - (MCM) (GHG17) | January 2017 |

Additions, Revisions, or Updates

| Publication Number / Title | Platform | Section Title | Change |
|----------------------------|------------------------|----------------------------|--|
| DDC-SVC-MAN-0191 | GHG17 - DD Platform | SPN 3720/FMI 14 - GHG17 | This is a new diagnostic procedure for GHG17 only. |

DiagnosticLink users: Please update the troubleshooting guides in DiagnosticLink with this newest version. To update the tool troubleshooting guide, open DiagnosticLink and from the Help – Troubleshooting Guides menu, select the appropriate troubleshooting manual, then click Update.



13400 Outer Drive, West, Detroit, Michigan 48239-4001
 Telephone: 313-592-5000
www.demanddetroit.com

2 SPN 3720/FMI 14 - GHG17

ACM Reported Ash Mileage is Lower Than MCM Stored Value

Check as follows:

1. Connect DiagnosticLink[®].
2. Turn the ignition ON (key ON, engine OFF).
3. Select Diesel Particulate Filter (DPF) ash accumulator from the actions drop-down menu.
4. Choose Aftertreatment Control Module (ACM) replacement option, then select set ash volume button.
5. Verify that the ACM value has changed in the DPF ash accumulator window and that the 3720/14 MCM fault is no longer active. ACM will change to a value that should be within 5% of the MCM displayed volume within 5-10 seconds of executing the routine. Clear all faults and release vehicle.