



Service Bulletin

File in Section: -

Bulletin No.: 17-NA-217

Date: October, 2017

TECHNICAL

Subject: Squeal Noise Originating from Front Brakes During Brake Apply

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	XT5	2017	2017			All	All
GMC	Acadia (VIN N)	2017	2017			All	All


Involved Region or Country	North America and N.A. Export Regions
Condition	Some customers may comment on a squeal noise from the front brakes during brake apply.
Correction	Apply a coat of paste between the shims of the front brake pads.

Parts Information

Description	Part Number	Region
LUBRICANT, ACDELCO M-77 PASTE (2.0 OZ/ 57g TUBE)	19356408	U.S.
	19356409	Canada
	19356526	Mexico
	19366553	Middle East

Service Procedure

1. Remove both of the front disc brake pads. Refer to *Front Disc Brake Pads Replacement* in SI.

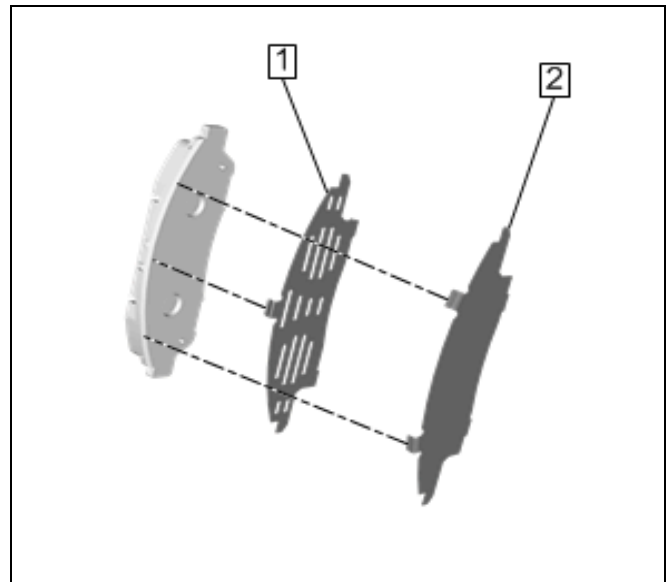

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2480328*	Applying Lubricant to Shims of the Front Brake Pads	0.7 hr
*This is a unique Labor Operation for Bulletin use only.		

4261515

Legend

- (1) Inner Disc Brake Pad Shim
- (2) Outer Disc Brake Pad Shim

- 2. Apply 2-4 grams of lubricant grease between the shims of both the inboard and outboard pads of the front calipers.
- 3. Reinstall components and verify the condition is corrected.

Version	2
Modified	October 20, 2017 — Updated Parts Information.

