



Service Bulletin

File in Section: -

Bulletin No.: 17-NA-284

Date: October, 2017

TECHNICAL

Subject: Reduced Steering Assist Message with DTC C0460 Sym 5A

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	XT5	2017	2018			All	All
GMC	Acadia (VIN N)	2017	2018			All	All

Involved Region or Country	North America and Export Regions
Condition	Some customers may comment on a Reduced Steering Assist message on the DIC with no loss of steering assist. During diagnosis a technician may find DTC C0460 Sym 5A.
Cause	The condition is due to Steering Angle Sensor trim error. Note: The calibration allows for an error to set without actual loss of assist.
Correction	Reprogram the Power Steering Control Module.

Service Procedure

If you encounter a vehicle with the above condition, use TIS2Web, SPS reprogramming to update the Power Steering Control Module with the latest calibration. Refer to *Power Steering Control Module Programming and Setup* in SI.

Parts Information

No parts needed for this condition.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2810625	Power Steering Control Module Reprogramming with SPS	Use Published Labor Operation Time

Version	2
Modified	October 02, 2017 – Adding 2018 model year.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION