

Service Bulletin

File in Section:

Bulletin No.: 17-NA-338

Date: October, 2017

TECHNICAL

Subject: Malfunction Indicator Lamp (MIL) Illuminated - DTC P0366 and/or P0014

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
Brand. Woder.	from	to	from	to			
Buick	Cascada	2017	2018			LWC	
Holden	Cascada	2017	2018			LVVC	

Involved Region or Country	North America
Condition	Some customers may comment that the MIL is illuminated. The technician may find one or more of the following DTCs set: P0366 P0014
Cause	This condition may be caused by a sporadically unlocked exhaust cam phaser that can oscillate during engine start, falsely setting the DTC/s.
Correction	If you encounter a vehicle with the above concern, reprogram the ECM software with the latest software available.

Service Procedure

Important: Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will interrupt programming. Install the *EL-49642* SPS Programming Support Tool to maintain system voltage. If not available, connect a fully charged 12 V jumper or booster pack disconnected from the AC voltage supply. DO NOT connect a battery charger. Update the Engine Control Module (ECM). Refer to *K20 Engine Control Module: Programming and Setup* in SI.

Parts Information

No parts are required for this repair.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2810075	Engine Control Module Reprogramming with SPS	Use Published Labor Operation Time

Version	1
Modified	Released October 24, 2017