

Missing images from 360° Camera in model series 205 & 253

Topic number	LI54.65-P-067500
Version	1
Function group	54.65 Parking assist
Date	12-18-2017
Validity	Vehicles of model series 205 & 253 with code 501
Reason for change	
Reason for block	

Complaint:

One or more 360° parking system cameras do not show an image in the display.

Cause:

Communication error in 360° Camera control unit (N148).

Remedy:

1. Carry out SCN coding of 360° Camera control unit (N148).
2. If a camera is still not producing an image after SCN coding, replace the required part as per EPC and then carry out calibration according to XENTRY instructions.

Symptoms
Communication/information / Warning and control system / Parking assist / 360° camera / Picture not complete
Communication/information / Warning and control system / Parking assist / 360° camera / No image

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
02-9446	CARRY OUT SCN CODING IN CONTROL UNIT N148 (WITH XENTRY/DAS CONNECTED)		8207T 90	
54-1826	REPLACE 360° CAMERA IN RIGHT OUTSIDE MIRROR (AFTER CHECK)		8207T 90	
54-1827	REPLACE 360° CAMERA IN LEFT OUTSIDE MIRROR (AFTER CHECK)		8207T 90	
54-1833	REPLACE FRONT 360° CAMERA (AFTER CHECK)		8207T 90	
54-1838	REPLACE REAR 360° CAMERA (AFTER CHECK)		8207T 90	
54-1836	ADJUST 360° CAMERA		8207T 90	

