

Noises from seat cushion on multicontour and dynamic seats

Topic number	LI91.25-P-065527
Version	1
Design group	91.25 Multicontour seat (MKS), dynamic seat
Date	01-12-2017
Validity	Model series 211 up to VIN A967490 with special equipment code 404 / 405 / 433 / 434
Reason for change	Damage code deleted
Reason for block	

Complaint:

Noises from seat cushion area on multicontour and dynamic seats.

Cause:

The cushion bladder in the multicontour or dynamic seat can cause noises at the interfaces with the support and covering.

Remedy:

1. Remove driver seat cushion
2. Pull off seat cushion covering
3. Replace the old bladder that is not encased in nonwoven fabric
4. Install in the reverse order

Symptoms
Body / Seat / Noises / Cracking
Body / Seat / Multicontour seat / Noise

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A0009101875			Bladder encased in nonwoven fabric (new)	1		X

WIS-References			
Document number	Title	Note	Allocation
ar91.10-p-3312t	Remove/install seat cushion cover		Remedy
ar91.25-p-1770t	Remove/install multicontour seat cushion air cushion		Remedy

