



SI B51 34 17  
Body Equipment

December 2017  
Technical Service

## WINDSHIELD WIPER HITTING A-PILLAR

New information provided by this revision is preceded by this symbol  .

### MODEL

G30 (5 Series Sedan)	
----------------------	--

Produced 11/1/16 thru 6/30/17

### SITUATION

Windshield wiper is hitting the A-pillar at the upper end of its travel.

### CAUSE

Wiper motor internal software causes excessive wiper travel.



Note: **The wiper motor software resides independently within the wiper motor assembly,**

**programming and encoding is not possible, nor necessary.**

### CORRECTION

Replace the wiper motor assembly with linkage. Range of motion is not an adjustable parameter.

### PROCEDURE

For conditions that are similar to the situation described:

Replace the wiper motor with linkage following standard repair procedures. Refer to ISTA REP 61 61 271, Removing and Installing the console for the windscreen wiper system including wiper motor”

### PARTS INFORMATION

Part Number	Description	Quantity
61 61 7 450 482	Wiper motor with linkage	1

### WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks or the BMW Certified Pre-Owned Program.

<b>Defect Code:</b>	<b>6763011200</b>	
<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>

61 61 271	Refer to KSD	Completely removing and installing the console for the windscreen wiper system including wiper motor (Main work).
Or:		
61 61 771	Refer to KSD	Completely removing and installing the console for the windscreen wiper system including wiper motor (Plus work).

If you are using a Main labor code for another repair, use the Plus code labor operation 61 61 771 instead of 61 61 271

[ Copyright ©2017 BMW of North America, Inc. ]