



Service Bulletin

TECHNICAL

Subject: **Steering Assist Reduced Message Displayed on Driver Information Center (DIC), Limited Steering Wheel Return to Center and/or Steering Feel - DTC C0460 5A Set**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Bolt EV	2017	2017	SOP	H4148792		

Involved Region or Country	North America and N.A. Export Regions
Condition	Some customers may comment on one or more of the following conditions: • Steering Assist Reduced message displayed on DIC • Steering feel degrades while driving • Steering wheel doesn't return to center The technician may find DTC C0460 5A set.
Cause	This condition may be caused by the steering angle sensor being too sensitively tuned to DTC C0460 5A, causing the calibration for the straight ahead position to be inaccurate.
Correction	If one or more of the following conditions has been validated, update the power steering control module calibration and center the steering angle sensor.

Parts Information

No parts are required for this repair.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2810625	Power Steering Control Module Reprogramming with SPS	Use Published Labor Operation Time

Service Procedure

Refer to *Power Steering Control Module Programming and Setup* in SI.

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from this information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION