

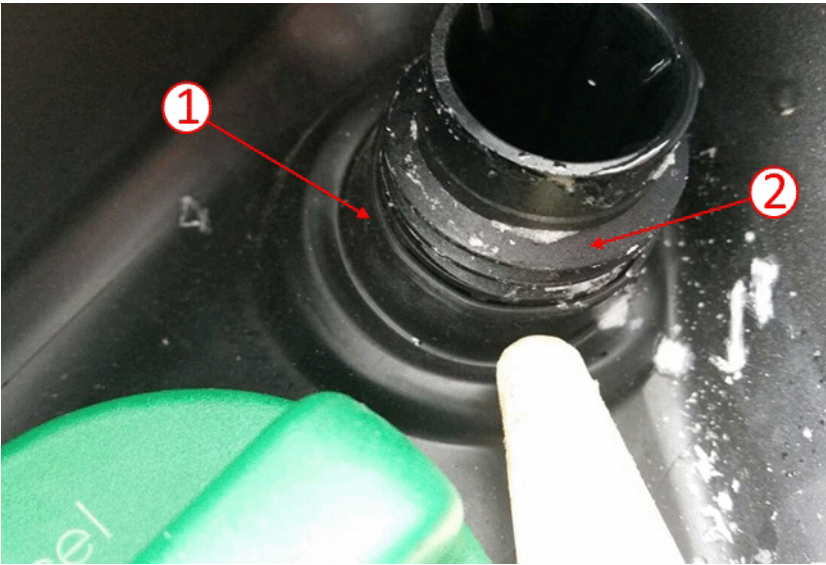


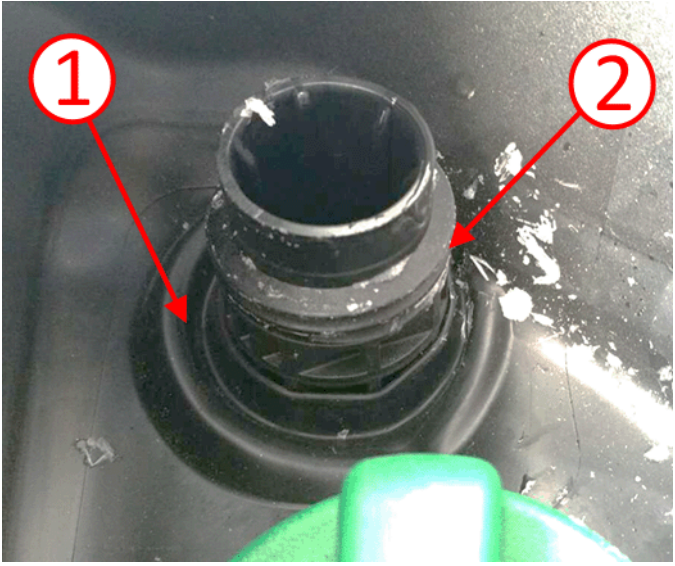
# Service Bulletin

## INFORMATION

**Subject:** Information on Diesel Exhaust Fuel (DEF) Leaking Past Filler Cap

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Colorado	2016	2017			LWN	
GMC	Canyon						

<b>Involved Region or Country</b>	North America
<b>Condition</b>	<p>Some customers may comment on one or more of the following conditions:</p> <ul style="list-style-type: none"> <li>• DEF leaking at the filler pipe.</li> <li>• DEF filler cap doesn't install completely/properly.</li> </ul>
<b>Cause</b>	 <p>This condition may be caused by the grommet (1) in the fuel housing expanded around the DEF filler pipe cap threads (2).</p>

<p><b>Correction</b></p>	 <p>Position the grommet (1) away from the DEF filler cap threads (2).</p>
--------------------------	---

**Parts Information**

No parts are required for this repair.

**Warranty Information**

Labor Operation	Description	Labor Time
4081558*	Reposition DEF Filler Pipe Grommet	0.2 hr
*This is a unique Labor Operation for Bulletin use only.		

<b>Version</b>	1
<b>Modified</b>	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION