



NUMBER: 07-004-17 REV. A

GROUP: 07 - Cooling

DATE: June 10, 2017

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

THIS BULLETIN SUPERSEDES TECHNICAL SERVICE BULLETIN 07-004-17, DATED MAY 06, 2017, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **ASTERISKS AND INCLUDES UPDATING THE BUILD DATE.**

THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL (RRT) 17-035. ALL APPLICABLE SOLD AND UN-SOLD RRT VIN's HAVE BEEN LOADED. TO VERIFY THAT THIS RRT SERVICE ACTION IS APPLICABLE TO THE VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.

SUBJECT:

Coolant Hose Retainer Clip Replacement

OVERVIEW:

This bulletin involves replacing a coolant hose retainer clip with a new style clip.

MODELS:

2017 (GA) Alfa Romeo Giulia

NOTE: This bulletin applies to vehicles within the following markets/countries: NAFTA.

NOTE: This bulletin applies to vehicles built on or before **October 05, 2016 (MDH 1005XX) equipped with a 2.9L V6 Twin Turbo Engine (Sales Code EED).**

SYMPTOM/CONDITION:

Some customers may hear a rubbing noise coming from the front of the vehicle.

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair.

PARTS REQUIRED:

Qty.	Part No.	Description
1	68341004AA	Clip, Retainer

REPAIR PROCEDURE:

1. Remove the under body protector. Refer to the detailed service procedures available in DealerCONNECT> TechCONNECT under: 13 - Frame and Bumpers/Under Body Protection/Belly Pan, Engine/Removal.

2. Locate the coolant hose retainer clip in the left front, just behind the radiator, see (Fig. 1) and (Fig. 2) .

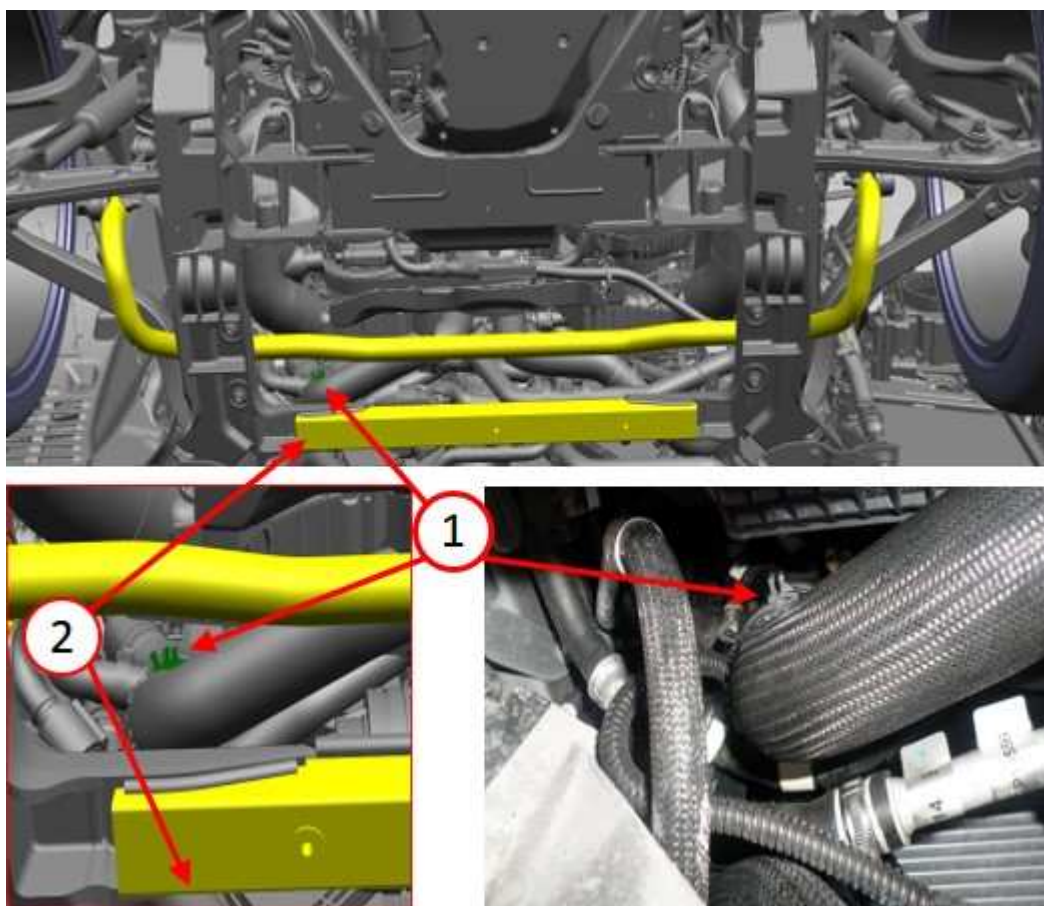


Fig. 1

Location of Coolant Hose Retainer Clip

- 1 - Retainer Clip
 - 2 - Front of Vehicle
-

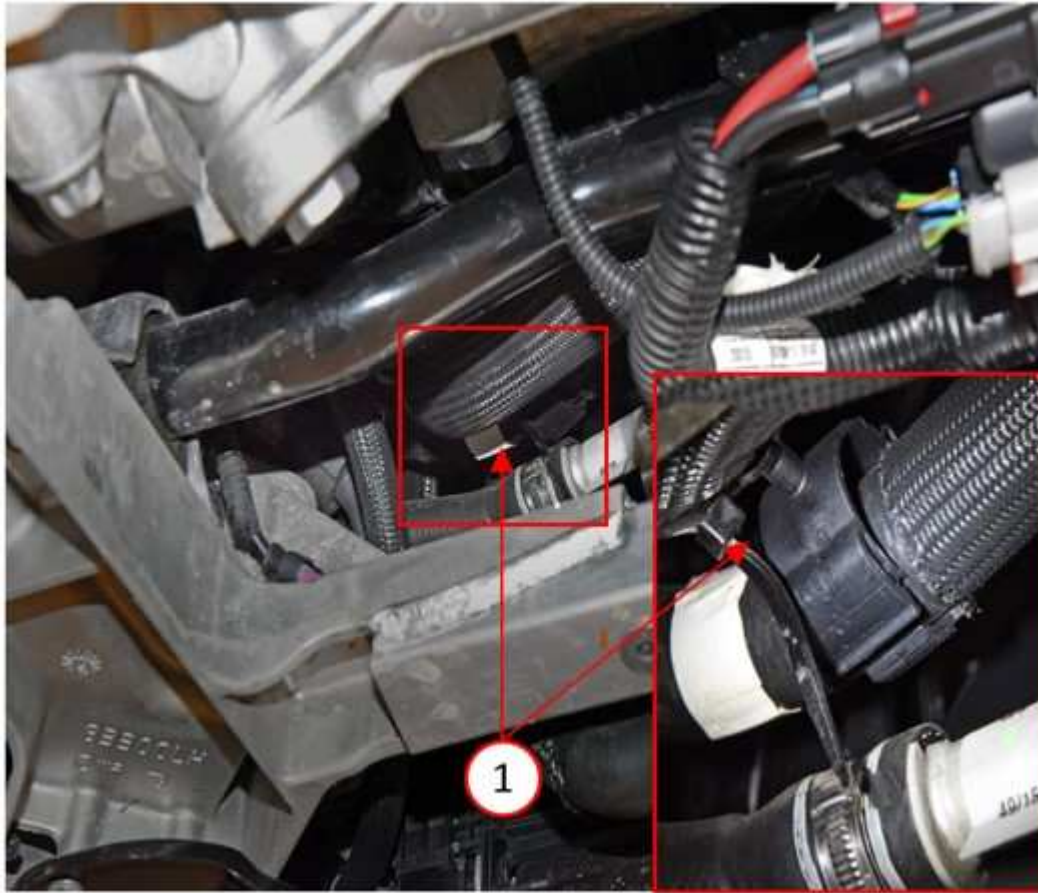


Fig. 2
Location of Retainer Clip

1 - Retainer Clip

3. Remove and discard the old style retaining clip from the coolant hose, see (Fig. 3) .



Fig. 3
Old Style Retainer Clip

4. Install the new style coolant hose retainer clip, see (Fig. 4) .



Fig. 4
New Style Retainer Clip

5. Install the under body protector. Refer to the detailed service procedures available in DealerCONNECT> TechCONNECT under: 13 - Frame and Bumpers/Under Body Protection/Belly Pan, Engine/Install.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
07-30-32-96	Clip/Retainer, Coolant Hose - Replace (0 - Introduction)	1 - Engine Repair and Performance	0.4 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------