

## **Service Bulletin**

File in Section:

Bulletin No.: 17-NA-290

Date: November, 2017

## **TECHNICAL**

Subject: Intermittent Blank/Missing Driver Information Center Info Pages Upon Start Up

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Camaro Colorado Impala Malibu	2017	2018	SOP	May 31, 2017	All	All
Chevrolet	Equinox	2018	2018			All	All
GMC	Canyon	2017	2018			All	All

Involved Region or Country	North America and N.A. Export Regions		
Additional Options (RPOs)	Equipped with Instrument Panel Cluster RPO UDD		
Condition	Some customers may comment that the Driver Information Center (DIC) info page goes blank/missing on start up at times while in the Info tab and if they try to go to the Option tab to edit the Info list, no info pages will be shown. However, after cycling the ignition, normal operation will resume again. All other apps (phone, navigation, etc.) will still work properly as well.		
Cause	This may be due to an Instrument Panel Cluster (IPC) software concern.		
Correction	If this concern is reported, compare the instrument panel cluster calibration/software part numbers to those in TIS2web to determine if any updated instrument panel cluster programming updates are available.  If so, program the instrument panel cluster as outlined in the Instrument Cluster Programming and Setup procedure in SI and re-evaluate the concern.		

## **Parts Information**

No parts needed for this condition.

## **Warranty Information**

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2810195	Instrument Cluster Reprogramming with SPS	Use Published Labor Operation Time

Version	2	
Modified	November 17, 2017 – Added the 2018 Chevrolet Equinox.	