



Service Bulletin

File in Section: -

Bulletin No.: 17-NA-347

Date: November, 2017

INFORMATION

Subject: Diagnostic Tip for Right and/or Left Rear Turn Signals Flashes too Fast

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Traverse	2018	2018				

Involved Region or Country	North America and NA Export vehicles
Condition	Some customers may comment on the right and/or left turn signal flashes to fast.
Cause	 4890855 4890864

	This condition may be caused when terminal #3 in the tail lamp connector being pulled out of the connector, or the wire being broken at the crimp. Note: In some cases the wire is broken internal to the insulation.
Correction	Replace the tail lamp harness.

Service Procedure

Refer to Tail Lamp Wiring Harness Replacement in SI.

Parts Information

Causal Part	Description	Part Number	Qty
X	CONNECTOR ASM-WRG HARN	13578533	1

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2041500	Tail Lamp Wiring Harness Replacement	Use Published Labor Operation Time

Version	1
Modified	Released November 06, 2017