



# Service Bulletin

File in Section: -

Bulletin No.: 17-NA-361

Date: November, 2017

## TECHNICAL

**Subject: Door Locks Inoperative, Airbag Lamp On, Malfunction Indicator Lamp (MIL) Illuminated - DTCs P129D, P305C and/or P305E Set**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Cruze (Gen II - VIN B)	2016	2017				

<b>Involved Region or Country</b>	North America, South America, Israel
<b>Condition</b>	<p>Some customers may comment on the following conditions:</p> <ul style="list-style-type: none"> <li>• Door locks inoperative</li> <li>• Airbag lamp on</li> <li>• MIL illuminated</li> </ul> <p>Some technicians may find one or more of the following DTCs set:</p> <ul style="list-style-type: none"> <li>• P129D</li> <li>• P305C</li> <li>• P305E</li> </ul> <p>Some technicians may also find fuse F32UA open.</p>
<b>Cause</b>	<div style="text-align: center;"> </div> <p style="text-align: right; font-size: small;">4892972</p> <p>This condition may be caused by the Instrument Panel wiring harness at the driver's door breakout (1) or the front collision alert wiring harness (2) pinched between the IP carrier and the A-pillar (3).</p>
<b>Correction</b>	<p>Remove the side IP trim cover, and with a suitable light, inspect the harness for being pinched.</p> <p>If the harness is found to be pinched, repair the harness as needed.</p>

## Service Procedure

Refer to *Wire to Wire Repair - Instrument Panel and Console* in SI.

## Parts Information

No parts are required for this repair.

## Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
1036102	Wire to Wire Repair - Instrument Panel and Console	Use Published Labor Operation Time

Version	1
Modified	Released November 16, 2017

Additional Keywords: B3125, B3130, B3135

